Waste Tank Summary Report for Month Ending DECEMBER 31, 2004



Prepared for the U.S. Department of Energy Assistant Secretary for Environmental Management

CH2MHILL

Hanford Group, Inc.

Richland, Washington

Contractor for the U.S. Department of Energy Office of River Protection under Contract DE-AC27-99RL14047

HNF-EP-0182, Rev. 201

LEGAL DISCLAIMER	
This report was prepared as an account of work sponsored by an agency of the United States Government.	Neithe
the United States Government nor any agency thereof, nor any of their employees, nor any of their contract	tors,

subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

This report has been reproduced from the best available copy.

Printed in the United States of America

CH2M HILL DOCUMENT RELEASE FORM

(1) Document Number:	HNF-EP-0182	(2) New Re Numbe		□ New	☐ Page Change	☑ Full ☐ Cancel Revision
(3) Impacted Documents:	HNF-EP-0182, Rev.	200	N	le Index umber:	NA	
			(5) Et	fective Date	e: Decemb	per 31, 2004
(6) Document Title:	Waste Tank Summa	ry Report for Month I	Ending Decem	ber 31, 20	004	
(7) Change/Release Description:	Complete revision - 7	Tables and text upda	ted each mon	th to reflec	ct new status	•
						•
(8) Change Justification:	DOE-ORP requires t	his document to be r	evised and iss	sued mont	thly	
		•				
	,					
(9) Approvals:						
(a) Author (Print/Sign B. M. Hanlon	Em Hanlor	·			Date: 2/17/	105
(b) Responsible Mana N. W. Kirch	ager (Print/Sign):				Date:	/os
(c) Reviewer (Optional	al, Print/Sign):				Date:	
(d) Reviewer (Optiona	al, Print/Sign):		·		Date:	
(10) Distribution:					(11) No. of	Pages: 47
(a) Name	(b) MSIN	(a) Name	(t) MSIN		Release Stamp
					16 199	
					DATE	HANFORD 1005
					STA:	RELEASE) ID:
						4
			<u></u>			
(12) HDCS?	Yes No	(13) Release	Γype: ⊠ Pub	lic Release		ternal Release
(,						

WASTE TANK SUMMARY REPORT FOR MONTH ENDING DECEMBER 31, 2004

BM HANLON

CH2M HILL HANFORD GROUP, INC.

Richland, WA 99352

U.S. Department of Energy Contract DE-AC27-99RL14047

EDT/ECN:

DRF

UC:

Cost Center:

Charge Code:

B&R Code:

Total Pages: 47

Key Words: MONTHLY REPORT, WASTE TANK SUMMARY

Abstract: SEE PAGE 9 (PURPOSE AND SCOPE)

TRADEMARK DISCLAIMER. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors.

Printed in the United States of America. To obtain copies of this document, contact: Document Control Services, P.O. Box 950, Mailstop H6-08, Richland WA 99352, Phone (509) 372-2420; Fax (509) 376-4989.

7. tof 2.24-05

Release Approval

Date

Release Stamp

DATE: STA:

Approved For Public Release

Tank Farm Contractor (TFC) RECORD OF REVISION

(1) Document Number HNF-EP-0182

Page 1

(2) Title

	Change Control	al Pagard							
	Change Control Record Authorized for Release								
(3) Revision	(4) Description of Change - Replace, Add, and Delete Pages	(5) Resp. Engr. (print/sign/date)	(6) Resp. Mgr. (print/sign/date)						
153	EDT-631372	BM Hanlon	JS Garfield						
RS 201	Incorporation of DRF (Full revision)	BM Hanlon 2/17/05	1 W Kirch 2/23/05						

Waste Tank Summary Report for Month Ending DECEMBER 31, 2004

Prepared for the U.S. Department of Energy Assistant Secretary for Environmental Management

CH2MHILL

Hanford Group, Inc.

Richland, Washington

Contractor for the U.S. Department of Energy Office of River Protection under Contract DE-AC27-99RL14047

Approved for Public Release; Further Dissemination Unlimited

HNF-EP-0182, Rev. 201

LEGAL	DICOL	AIRACD
LEGAL	UIDLL	AIMER

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, nor any of their contractors, subcontractors or their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or any third party's use or the results of such use of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise, does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof or its contractors or subcontractors. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

This report has been reproduced from the best available copy.

Printed in the United States of America

Waste Tank Summary Report for Month Ending DECEMBER 31, 2004

B. M. Hanlon CH2M HILL Hanford Group, Inc.

Date Published February 2005

Prepared for the U.S. Department of Energy Assistant Secretary for Environmental Management

CH2MHILL

Hanford Group, Inc.

Richland, Washington

Contractor for the U.S. Department of Energy Office of River Protection under Contract DE-AC27-99RL14047

Approved for Public Release; Further Dissemination Unlimited

This page intentionally left blank.

CONTENTS

1.0	PURPOSE AND	SCOPE	
2.0	WASTE TANK	STATUS	10
	2.1 Waste Tank	Status Highlights	16
	Table 2-1.	Single-Shell Tanks in Retrieval Status	
	Table 2-2.	Single-Shell Tanks Declared Interim Stabilized	
3.0	DOUBLE-SHEL	L TANKS MONTHLY SUMMARY TABLES	12
	Table 3-1.	Inventory and Status by Tank - Double-Shell Tanks	12
	Table 3-2.	Double-Shell Tank Space Allocation, Inventory, and Waste Receipts	
4.0	SINGLE-SHELL	TANKS MONTHLY SUMMARY TABLES	14
	Table 4-1.	Inventory and Status by Tank - Single-Shell Tanks	14
	Table 4-2.	Single-Shell Tanks Interim Stabilization Status	18
	Table 4-3.	Single-Shell Tanks Interim Stabilization Milestones	22
	Table 4-4.	Single-Shell Tanks Leak Volume Estimates	24
5.0		JS UNDERGROUND STORAGE TANKS AND SPECIAL E FACILITIES	30
	Table 5-1.	East and West Area Miscellaneous Underground Storage Ta and Special Surveillance Facilities	nks
	Table 5-2.	East Area Inactive Miscellaneous Underground Storage Tan and Special Surveillance Facilities	
	Table 5-3.	West Area Inactive Miscellaneous Underground Storage Tar and Special Surveillance Facilities	nks
		APPENDICES	
APPEN	DIX A - TANK CON	NFIGURATION AND FACILITIES CHARTS	A-1
	Figure A-1. Hig	h Level Waste Tank Configuration	A-1
	Figure A-2. Dou	ıble-Shell Tank Instrumentation Configuration	A-2
		gle-Shell Tank Instrumentation Configuration	
		East Tank Waste Contents	
		West Tank Waste Contents	
	-	ford Tank Farm Facilities 200 East	
	Figure A-7. Han	ford Tank Farm Facilities 200 West	\ /10/11

ACRONYMS

BBI Best Basis Inventory

CH2M HILL CH2M HILL Hanford Group, Inc.
DCRT Double-Contained Receiver Tank
DIL Drainable Interstitial Liquid
DLR Drainable Liquid Remaining

DST Double-Shell Tank

FSAR Final Safety Analysis Report effective October 18, 1999

Gal Gallon

GPM Gallons Per Minute
ILL Interstitial Liquid
Kgal Kilogallons
IS Interim Stabilized

MT/FIC/ Manual Tape, Food Instrument Corporation, ENRAF Corporation (surface level measurement

ENRAF devices)

OSD Operating Specifications Document

PFP Plutonium Finishing Plant

SHMS Standard Hydrogen Monitoring System

SST Single-Shell Tank SWL Salt Well Liquid

TMACS Tank Monitor and Control System

TPA Hanford Federal Facility Consent and Compliance Order, "Washington State Department of

Ecology, U.S. Environmental Protection Agency, and U.S. Department of Energy," as amended

(Tri-Party Agreement)

TSR Technical Safety Requirement

TWINS Tank Waste Information Network System

USQ Unreviewed Safety Question

GLOSSARY

General

<u>Characterization</u> - Characterization is understanding the Hanford tank waste chemical, physical, and radiological properties to the extent necessary to ensure safe storage and interim operation, and ultimate disposition of the waste.

<u>Drainable Interstitial Liquid (DIL)</u> -Drainable Interstitial Liquid is calculated based on saltcake and sludge volumes, calculated porosity values. Interstitial liquid is the liquid that fills the interstitial spaces of the solids waste. The sum of the interstitial liquid contained in saltcake and sludge minus an adjustment for capillary height is the initial volume of DIL. Interstitial liquid that is not held in place by capillary forces will, therefore, migrate or move with gravity.

<u>Drainable Liquid Remaining (DLR)</u> - The total Drainable Liquid Remaining is the sum of drainable interstitial liquid and supernatant.

<u>Supernatant Liquid</u> - The liquid above the solids or in large liquid pools covered by floating solids in waste storage tanks.

<u>Total Waste</u> - For purposes of this document, solids volume (sludge and saltcake including liquids) plus supernatant liquid.

<u>Waste Tank Safety Issue</u> - A potentially unsafe condition in the handling of waste material in underground storage tanks that requires corrective action to reduce or eliminate the unsafe condition. There are currently no waste tank safety issues.

Interim Stabilization (Single-Shell Tanks only)

Interim Stabilized (IS) - A tank which contains less than 50 Kgallons of drainable interstitial liquid and less than 5 Kgallons of supernatant. If the tank was jet pumped to achieve interim stabilization, then the jet pump flow or saltwell screen inflow must also have been at or below 0.05 gpm before interim stabilization criteria are met.

<u>Jet Pump</u> - The centrifugal pump and jet assembly are needed to pump the interstitial liquid from the saltwell screen into the pump pit, nominally a 40-foot elevation rise. Pumping rates vary from 0.05 to about 4 gpm.

Saltwell Screen - The saltwell system is a 10-inch diameter saltwell casing consisting of a stainless steel saltwell screen welded to a Schedule 40 carbon steel pipe. The casing and screen are to be inserted into the 12-inch tank riser located in the pump pit. The stainless steel screen portion of the system will extend through the tank waste to near the bottom of the tank.

Retrieval/Closure-(Single-Shell Tanks only)

Closure (C) - Final closure of the operable units (tank farms) shall be defined as regulatory approval of completion of closure actions and commencement of post-closure actions. For the purposes of this agreement (Hanford Federal Facility Agreement and Consent Order Change Control Form, Change Number M-45-02-03), all units located within the boundary of each tank farm will be closed in accordance with Washington Administrative Code 173-303-610.

Retrieval (R) - The process of removing, to the maximum extent practical, all the waste from a given underground storage tank. The retrieval process is selected specific to each tank and accounts for the waste type stored and the access and support systems available. Generally, retrieval is focused on removal of solids from the tank.

Tank Integrity

<u>Assumed Leaker</u> - The integrity classification of a waste storage tank for which surveillance data indicate a loss of liquid attributed to a breach of integrity.

<u>Sound</u> - The integrity classification of a waste storage tank for which surveillance data indicate no loss of liquid attributed to a breach of integrity.

Surveillance Instrumentation

<u>Annulus</u> - The annulus is the space between the inner and outer shells on <u>DSTs</u> only. Drain channels in the insulating and/or supporting concrete carry any leakage to the annulus space where conductivity probes are installed. The annulus conductivity probes and radiation detectors are the primary means of leak detection for all DSTs.

<u>Automatic FIC</u> - An automatic waste surface level measurement device is manufactured by the Food Instrument Corporation (FIC). The instrument consists of a conductivity electrode (plummet) connected to a calibrated steel tape, a steel tape reel housing and a controller that automatically raises and lowers the plummet to obtain a waste surface level reading. All FIC gauges are read manually. FICs are being replaced by ENRAF detectors (see below).

<u>Drywells</u> - Historically, the drywells were monitored with gross logging tools as part of a secondary leak monitoring system. In some cases, neutron-moisture sensors were used to monitor moisture in the soil as a function of well depth, which could be indicative of tank leakage. The routine gross gamma logging data were stored electronically from 1974 through 1994; a program was initiated in 1995 to log each of the available drywells in each tank farm with a spectral gamma logging system. The spectral gamma logging system provides quantitative values for gamma-emitting radionuclides. The baseline spectral gamma logging database is available electronically.

Spectral drywell scans can be run by special request. A select subset of drywells is routinely monitored by the Vadose Zone Characterization Project to assess movement of gamma-emitting radionuclides in the subsurface.

ENRAF 854 ATG Level Detector - FICs and some manual tapes are in the process of being replaced by the ENRAF ATG 854 level detector. The ENRAF gauge, fabricated by ENRAF Incorporated, determines waste level by detecting variations in the weight of a displacer suspended in the tank waste. ENRAFs and future installations will transmit digital level data to TMACS via an ENRAF Computer Interface Unit (CIU). The CIU allows fully remote communication with the gauge, minimizing tank farm entry.

<u>Laterals</u> - Laterals are horizontal drywells positioned 8 to 10 feet under single-shell waste storage tanks, 3 per tank, to detect radionuclides in the soil which could be indicative of tank leakage. These drywells can be monitored by radiation detection probes. Laterals are located only in A and SX farms. There are currently no functioning laterals and no plan to prepare them for use.

<u>Liquid Observation Well (LOW)</u> - In-tank liquid observation wells are used for monitoring the ILL in single-shell tanks. The wells are usually constructed of fiberglass or TEFZEL-reinforced epoxy-polyester resin (TEFZEL is a trademark of E. I. du Pont de Nemours & Company). A few LOWs constructed of steel. Gamma and neutron probes are used to monitor changes in the ILL, and can indicate intrusions or leakage by increases or decreases in the ILL. There are 70 LOWs installed in SSTs that contain or are capable of containing greater than 50 Kgallons of drainable interstitial liquid. All of the LOWs are monitored weekly with the exception of TX-108 which is monitored by request only. Two LOWs installed in DSTs SY-102 and AW-103 are used for special, rather than routine, surveillance purposes only.

<u>Surface Levels</u> - The surface level measurements in all waste storage tanks are monitored by manual or automatic conductivity probes, and recorded and transmitted or entered into the Surveillance Analysis Computer System.

<u>Thermocouple (TC)</u> - A thermocouple is a thermoelectric device used to measure temperature. More than one thermocouple element on a device (probe) is called a thermocouple tree.

METRIC CONVERSION CHART

METRIC CONVERSION CHART						
1 inch = 2.54 centimeters						
1 foot	=	30.48 centimeters				
1 gallon	=	3.79 liters				
1 ton = 0.91 metric tons						
op (9 og), 22						

(5)

1 Btu/h = 0.2931 watts (International Table)

1.0 PURPOSE AND SCOPE

This report is the official inventory for radioactive waste stored in underground tanks in the 200 Areas at the Hanford Site. Data that depict the status of stored radioactive waste and tank vessel integrity are contained within the report. This report provides data on each of the existing 177 large underground waste storage tanks and 60 smaller miscellaneous underground storage tanks and special surveillance facilities, and supplemental information regarding tank surveillance anomalies and ongoing investigations. This report is intended to meet the requirement of U.S. Department of Energy Order 435.1 (DOE-HQ, August 28, 2001, Radioactive Waste Management, U.S. Department of Energy-Washington, D.C.) requiring the reporting of waste inventories and space utilization for the Hanford Site Tank Farm tanks.

2.0 WASTE TANK STATUS

Note: Changes from the previous month are in **bold print**.

Double-Shell Tanks (DST)	28 double-shell	10/86 - date last DST tank was completed
Single-Shell Tanks (SST)	149 single-shell	1966 - date last SST tank was completed
Assumed Leaker Tanks	67 single-shell	07/93 - date last Assumed Leaker was identified
Sound Tanks	28 double-shell 82 single-shell	1986 - date DSTs determined sound 07/93 - date last SST determined sound
Interim Stabilized Tanks ^a (IS)	149 single-shell	03/04 - date last IS occurred ^a
Retrieval ^b	13 single-shell	12/03 - date last Retrieval completed
Misc. Underground Storage Tanks (MUST) and Special Surveillance Facilities (Active)	10 Tanks East Area 7 Tanks West Area	03/01 - last date a tank was added or removed from MUST list
Misc. Underground Storage Tanks (IMUST) and Special Surveillance Facilities (Inactive) ^c	18 Tanks East Area 25 Tanks West Area	11/01 - last date a tank was added or removed from IMUST list

Footnotes:

Saltwell pumping for the tanks covered by the Consent Decree was completed in March 2004. (Tank C-106 is not included in the Consent Decree and is not Interim Stabilized; Retrieval was completed December 31, 2003). Interim Stabilization documentation has not yet been completed on two tanks: BY-106 and S-111.

^a Tanks are declared Interim Stabilized when pumping stops; the tank may be placed in evaluation at this time. Tank U-108 was placed in evaluation on March 18, 2004, due to major equipment failure; documentation was completed August 16 and the declaration letter sent to DOE-RL on September 8, 2004.

b Tank status for C-104, C-201, C-202, C-203, C-204, S-102, S-103, S-105 and S-106 was changed to "Retrieval," effective October 2002. Tank status for C-103, C-105, C-106, and S-112 was changed to "Retrieval" in October 2003. Retrieval was completed for tank C-106 on December 31, 2003. Hanford Federal Facility Agreement and Consent Order (signed August 2004) modified Milestone M-45-00C (Change Order M-45-04-01) changing the regulatory requirements for retrieval of waste in tanks S-103, S-105, and S-106. "Retrieval" status in these tanks is thereby rescinded to allow focusing on the retrieval of wastes and the interim closure of all Waste Management Area C-Farm Single-Shell Tanks.

^c Tables 5-2. and 5-3., the Inactive Miscellaneous Underground Storage Tanks (IMUST) now reflect only those tanks managed by CH2M HILL Hanford Group, Inc. (CH2M HILL).

2.1 WASTE TANK STATUS HIGHLIGHTS

Table 2-1. Single-Shell Tanks in Retrieval Status

Tank Number	Comments
241-C-103	
241-C-104	
241-C-105	
241-C-106	Declared "Retrieval Completed," December 31, 2003
241-C-200 series	C-203 - Retrieval in progress - July 2004
241-S-102	Retrieval initiated on December 17, 2004
241-S-103	Status rescinded by HFFACO, August 2004
241-S-105	Status rescinded by HFFACO, August 2004
241-S-106	Status rescinded by HFFACO, August 2004
241-S-112	Retrieval in progress

Table 2-2. Single-Shell Tanks Declared Interim Stabilized (confirmation letter to DOE not yet sent)

241-BY-106	December 31, 2003 (in evaluation)
241-S-111	December 15, 2003 (in evaluation-major equipment failure)

Tank AX-103

The interstitial liquid level (ILL) readings are taken quarterly via neutron probe in a liquid observation well (LOW) in this tank. On December 12, 2004, the LOW reading indicated a 2.7-inch decrease from the previous reading (July 5); a repeated reading on December 16 confirmed the decrease. Problem evaluation report (PER)/Occurrence Report RP 2004-0070 "Tank 241-AX-103 Liquid Waste Level Below Established Baseline" was issued.

The LOW reading frequency was increased to weekly. An Assessment team was formed and the assessment process initiated per TFC-ENG-CHEM-D-42, "Tank Leak Assessment Process." The LOW level has increased from the December 12 reading.

The surface level (ENRAF) and leak detection pit levels have shown no change.

3.0 DOUBLE-SHELL TANKS MONTHLY SUMMARY TABLES

Table 3-1. Inventory and Status by Tanks - Double-Shell Tanks.

All volume data obtained from Tank Waste Information Network System (TWINS))		
Waste Volumes								
Tank	Tank Integrity	Tank Level (inches)	Total Waste (Kgal)	Available Space (Kgal)	Supernatant Liquid (Kgal)	Sludge (Kgal)	Saltcake (Kgal)	Solids Volume Update
			241-A	N TANK FAR	M STATUS			
AN-101	SOUND	349	959	185	928	0	31	12/31/03
AN-102	SOUND	389	1070	74	936	0	134	12/31/02
AN-103	SOUND	349	960	184	501	0	459	06/30/99
AN-104	SOUND	384	1055	89	610	0	445	06/30/99
AN-105	SOUND	409	1126	18	588	0	538	01/31/03
AN-106	SOUND	324	891	253	845	29	17	03/31/04
AN-107	SOUND	400	1101	43	871	0	230	12/31/03
7 TANKS -	TOTAL		7162	846	5279	29	1854	
			241-A	P TANK FAR	M STATUS			
AP-101	SOUND	405	1115	29	1115	0	0	05/01/89
AP-102	SOUND	399	1097	47	1074	23	0	05/31/02
AP-103	SOUND	325	893	251	893	0	0	05/31/96
AP-104	SOUND	400	1099	45	1099	0	0	10/13/88
AP-105	SOUND	414	1139	5	1050	0	89	06/30/99
AP-106	SOUND	413	1135	9	1135	0	0	10/13/88
AP-107	SOUND	76	208	936	208	0	0	10/13/88
AP-108	SOUND	296	815	329	815	0	0	10/13/88
8 TANKS -	TOTAL		7501	1651	7389	23	89	
				W TANK FAI			1	
AW-101	SOUND	410	1128	16	732	0	396	01/31/03
AW-102	SOUND	378	1039	86	1032	7	0	03/31/04
AW-103	SOUND	400	1099	45	786	273	40	06/30/99
AW-104	SOUND	391	1074	70	851	66	157	06/30/99
AW-105	SOUND	153	420	724	157	263	0	06/30/99
AW-106	SOUND	328	901	243	618	0	283	04/12/04
6 TANKS -	TOTAL		5661	1184	4176	609	876	
				Y TANK FAR		0.6	.1	0.6/0.0/0.0
AY-101	SOUND	65	180	821	84	96	0	06/30/99
AY-102	SOUND	324	892	109	741	151	0	04/12/04
2 TANKS -	TOTAL		1072	930	825	247	0	·
				Z TANK FAR			.1	
AZ-101	SOUND	328	901	100	849	52	0	06/30/98
AZ-102	SOUND	357	983	18	878	105	0	06/30/99
2 TANKS -	TOTAL		1884	118	1727	157		
				Y TANK FAR			1	
SY-101	SOUND	139	381	. 763	106	0	275	. 06/30/99
SY-102	SOUND	280	769	375	624	145	0	09/30/03
SY-103	SOUND	269	740	404	398	0	342	06/30/99
3 TANKS -	TOTAL		1890	1542	1128	145	617	

Notes:

1 Kgal differences are the result of computer rounding

Supernatant + Sludge (includes liquid) + Saltcake (includes liquid) = Total Waste

Available Space Volumes include restricted space

Tanks AN-103, AN-104, AN-105, SY-101 and SY-103 contain retrained gas in the saltcake

Table 3-2. Double-Shell Tank Space Allocation, Inventory and Waste Receipts (all volumes in kgallons)

TOTAL DST CAPA	CITY	TOTAL DST WASTE INVENTORY
OTAL=	31,441	INVENTORY ON 12/31/04 25,1
		INVENTORY ON 11/30/04 25,0
		CHANGE =

ALLOCATION OF REMAINING DST SPACE	
TOTAL DST CAPACITY =	31,441
WASTE INVENTORY =	-25,169
(*) DEDICATED OPERATIONAL SPACE =	-2,000
(**) RESTRICTED USAGE SPACE =	-1,735
(***)EMERGENCY SPACE ALLOCATION =	-1,200
REMAINING AVAILABLE SPACE =	1,337

- (*) Dedicated Operational Space is assumed to equal 2 Mgal for SST retrieval, cross-site transfer receiver, and evaporator feed and slurry.

 (**) Restricted space associated with flammable gas Waste Group A and tanks controlled for waste feed delivery per Feed Control List, HNF-SD-WM-OCD-015, Tank Farms Waste Transfer Compatibility report. These tanks are: AN-102, -103, -104, -105, -107, AP-101; AW-101, -103, -105, AY-102, and SY-103 (AY-102 is allowed to receive condensate only). Restricted Space does not include Feed Control List tanks AY-101, AZ-102, and SY-102, which are allowed to receive limited types of waste.
- (***) Emergency Space Allocation adjusted in July 2003 per HNF-3484 Rev. 4, includes space for WTP returns.

		DECEMBER DS1	WASTE RECEIPTS		
FACILITY GE	ENERATIONS	OTHER GAINS AS	SOCIATED WITH	OTHER LOSSES ASSO	OCIATED WITH
	1	SLURRY	6	SLURRY	4
EADMS	5	CONDENSATE	7	CONDENSATE	8

1	SLURRY	6	ISLURRY	4 4
			5551411	·
5	CONDENSATE	7	CONDENSATE	8
0	INSTRUMENTATION	2 -	INSTRUMENTATION	0
9	MISCELLANEOUS GAINS	4	MISCELLANEOUS LOSSES	4
73				
88	TOTAL=	19	TOTAL=	16
	5 0 9 73	0 INSTRUMENTATION 9 MISCELLANEOUS GAINS 73	0 INSTRUMENTATION 2 - 9 MISCELLANEOUS GAINS 4 73	0 INSTRUMENTATION 2 - INSTRUMENTATION 9 MISCELLANEOUS GAINS 4 MISCELLANEOUS LOSSES 73

WASTE RECEIPT AND EVAPORATOR METRIC								
DATE	DST WASTE RECEIPTS	MISC. DST CHANGES (+/-)	WVR(1)	NET DST CHANGE	TOTAL DST VOLUME			
12/04	88	3	0	91	25,169			

(1) WVR is total (before flush) waste volume reduction for 242-A Evaporator

IMPLEMENTATION OF DST SPACE OPTIONS METRIC										
	(TPA MILESTONE M-46-21)									
DATE	INITIATIVES GAINS TO DATE (1) GAINS DURING MONTH									
12/04	INCREASE DST FILL HEIGHT	0	0							
	NET EVAPORATOR WVR									
	RESERVE EMERGENCY SPACE COMPLIANT WITH DOE 0435.1	1100	0							
	USE RESTRICTED HEADSPACE	0	0							
	TOTAL.	2804	0							

- (1) DST tank space gains since 10/1/02.
- (2) WVR is net (after flush) waste volume reduction for 242-A Evaporator

4.0 SINGLE-SHELL TANKS MONTHLY SUMMARY TABLES

Table 4-1. Inventory and Status by Tanks - Single-Shell Tanks (sheet 1 of 4).

All volume data obtained from Tank Waste Information Network System (TWINS)

					ii i ank waste		ste Volur				
				Super-	Drainable			Drinable	Ī		
			Total		Interstitial	this	Total	Liquid		Salt-	Solds
Tank	Tank	Tank	Waste	Liquid	Liquid			Remaining	Sludge	cake	Volume
Number		Status	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	Update
				-	41-A TANK F						
A-101	SOUND	IS(4)	320	0	37	0	542	37	3	317	06/30/04
A-102	SOUND	IS	40	3	9	0	40	12	0	37	01/31/03
A-103	ASMD LKR	IS	370	4	87	0	111	92	2	364	01/01/02
A-104	ASMD LKR	1S	28	0	0	0	0	0	28	0	01/27/78
A-105	ASMD LKR	1S	37	0	0	0	0	0	37	0	10/31/00
A-106	SOUND	18	79	0	9	0	0	9	50	29	01/01/02
6 TANKS	- TOTAL		874						120	747	
				24	1-AX TANK F	ARM STA	TUS				
AX-101	SOUND	IS	358	0	44	0	369	44	3	355	12/31/03
AX-102	ASMD LKR	IS	30	0	0	0	13	0	6	24	01/01/02
AX-103	SOUND	IS	107	0	22	0	0	22	8	99	09/30/03
AX-104	ASMD LKR	IS	7	0	0	0	0	0	7	0	01/01/02
4 TANKS	- TOTAL		502						24	478	
				2	41-B TANK FA	ARM STAT	US				
B-101	ASMD LKR	IS	109	0	20	0	0	20	28	81	01/01/02
B-102	SOUND	IS	32	4	7	0	. 0	11	0	28	06/30/99
B-103	ASMD LKR	IS	56	0	10	0	0	10	1	55	01/01/02
B-104	SOUND	IS	374	0	45	0	0	45	309	65	01/01/02
B-105	ASMD LKR	IS	290	0	20	0	0	20	28	262	01/01/02
B-106	SOUND	IS	123	1	8	0	0	9	122	0	12/31/03
B-107	ASMD LKR	IS	161	0	23	0	0	23	86	75	01/01/02
B-108	SOUND	IS	92	0	19	0	0	19	27	65	06/30/04
B-109	SOUND	1S	125	0	23	0	0	23	50	75	01/01/02
B-110	ASMD LKR	IS	245	1	27	0	0	28	244	0	01/01/02
B-111	ASMD LKR	IS	242	1	23	0	0	24	241	0	01/01/02
B-112	ASMD LKR	IS	35	3	2	0	0	5	15	17	01/01/02
B-201	ASMD LKR	IS	29	0	5	0	0	5	29	0	07/01/04
B-202	SOUND	IS	28	0	4	0	0	4	28	0	07/01/04
B-203	ASMD LKR	IS	50	1	5	0	0	6	49	0	07/01/04
B-204	ASMD LKR	IS	49	1	5	0	0	6	48	0	07/01/04
16 TANKS	S - TOTAL		2040						1305	723	
				24	1-BX TANK F	ARM STAT	rus				
BX-101	ASMD LKR	IS	48	0	4	0	0	4	48	0	01/01/02
BX-102	ASMD LKR	IS	79	0	0	0	0	0	79	0	06/30/04
BX-103	SOUND	IS	74	12	4	0	0	15	62	0	11/29/83
BX-104	SOUND	IS	100	3	4	0	17	7	97	0	01/01/02
BX-105	SOUND	IS	72	5	4	0	15	9	67	0	01/01/02
BX-106	SOUND	IS	38	0	4	0	14	4	38	0	01/01/95
BX-107	SOUND	IS	347	0	37	0	23	37	347	0	09/18/90
BX-108	ASMD LKR	IS	31	0	4	0	0	4	31	0	01/31/01
BX-109	SOUND	IS	193	0	25	0	8	25	193	0	09/17/90
BX-110 A	ASMD LKR	IS	205	1	35	0	2	36	65	139	01/01/01
BX-111 A	ASMD LKR	IS	189	0	6	0	117	6 i	32	157	01/01/02
BX-112	SOUND	IS	164	1	9	0	4	10	163	0	01/01/02
12 TANKS	· TOTAL		1540						1222	296	

Table 4-1. Inventory and Status by Tank - Single-Shell Tanks (sheet 2 of 4).

All volume data obtained from Tank Waste Information Network System (TWINS)								k System (T			
						Waste	Volumes				
Tank	Tank	Tank	Total Waste	Super- natant Liquid	Interstitial Liquid	Pumped this Month	Total Pumped	Drainable Liquid Remaining			Solids Volume
Number	Integrity	Status	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	Update
777.404	got nin	T.C.	200		41-BY TANK FAI		_	24	1 27	333	01/01/02
BY-101 BY-102	SOUND SOUND	IS IS	370 279	0	24	0	36 159	24 40	37 0	279	06/30/04
1	ASMD LKR	IS	417	0	. 40	0	96	58	9	408	01/31/03
BY-103	SOUND	IS	358	0	. 51	0	330	51	45	313	01/01/03
BY-105	ASMD LKR	IS	481	0	47	0	45	47	48	433	03/31/03
BY-106	ASMD LKR	IS	462		*	0	99	-	32	430	12/31/03
BY-107	ASMD LKR	IS	272	0	42	0	56	42	16	256	06/30/04
BY-108	ASMD LKR	IS	222	0	33	0	28	33	40	182	01/01/02
BY-109	SOUND	IS	287	0	37	0	157	37	24	263	06/30/04
BY-110	SOUND	IS	366	0	20	0	213	20	43	323	01/01/02
BY-111	SOUND	IS	301	0	14	0	313	14	0	301	06/30/04
BY-112	SOUND	IS	286	0	24	0	116	24	2	284	03/31/02
12 TANK	S - TOTAL		4101						296	3805	
<u> </u>					241-C TANK FAR	M STATU	S		<u> </u>	·	<u> </u>
C-101	ASMD LKR	IS	88	l 0 -	4	0	0	4	88	0	11/29/83
C-102	SOUND	IS	316	0	62	0	47	62	316	0	09/30/95
C-103	SOUND	IS/R	72	1	10	0	114	11	71	0	12/31/03
C-104	SOUND	IS/R	259	0	29	0	0	29	259	0	01/01/02
C-105	SOUND	IS/R	132	0	10	0	0	10	132	0	02/29/00
C-106	SOUND	/R	3	Retrieval Co	mpleted, 12/31/03	0	523	-	3	0	12/31/03
				See Foots	note (1), page 17						
C-107	SOUND	IS	247	0	30	0	41	30	247	0	06/30/04
C-108	SOUND	IS	66	0	4	0	0	4	66	0	02/24/84
C-109	SOUND	IS	63	0	4	0	0	4	63	0	06/30/04
C-110	ASMD LKR	IS	178	1	37	0	16	38	177	0	06/14/95
C-111	ASMD LKR	IS	57	0	4	0	0	4	57	0	06/30/04
C-112	SOUND	IS	104	0	. 6	0	0	. 6	104	0	09/18/90
C-201	ASMD LKR	IS/R	1	0	0	0	0	0	1	0,	01/01/02
C-202	ASMD LKR	IS/R	0	See Foots	note (2), page 17	0	0	0	0	0	06/30/04
C-203	ASMD LKR	IS/R	1	Retriev	val in progress	0	22	-	1	0	07/31/04
C-204	ASMD LKR	IS/R	2	0	0	0	0	0	2	0	01/31/03
16 TANK	S - TOTAL		1589						1587	0	
1					241-S TANK FAR	M STATU	S				
S-101	SOUND	IS	352	0	45	0		45	235	117	04/31/04
S-102	SOUND	/R	541	13	-	9	71	•	22	416	06/30/03
S-103	SOUND	IS (3)	237	1	45	0	24	46	9	227	06/30/04
S-104	ASMD LKR	IS (4)	288	0	49	0	0	49	132	156	12/20/84
S-105	SOUND	IS (3)	406	0	42	0	114	42	2	404	01/01/02
S-106	SOUND	IS (3)	455	0	26	0	204	26	0	455	02/28/01
S-107	SOUND	IS	358	0	42	0	82	42	320	38	02/04/04
S-108	SOUND	IS	550	0	4	0	200	4	5	545	01/01/02
S-109	SOUND	IS	533	0	16	0	. 34	16	13	520	06/30/01
S-110	SOUND	IS	389	0	30	0	203	30	96	293	01/01/02
S-111	SOUND	IS (4)	411	-	-	0	100	-	76	335	06/30/04
S-112	SOUND	/R	48	0	-	73	1573	<u> </u>	6	78	10/31/04
12 TANK	S - TOTAL		4568		<u> </u>				916	3584	ļ

Table 4-1. Inventory and Status by Tank - Single-Shell Tanks (sheet 3 of 4).

	All volume data obtained from Tank Waste Information Network System (TWINS)										
						Was	te Volum	ies	`		
				Super-	Drainable	_		Drainable			
			Total	natant	Interstitial	this	Total	Liquid		Salt-	Solids
Tank	Tank	Tank	Waste	Liquid	Liquid			Remaining		cake	Volume
Number	Integrity	Status	(Kgal)	(Kgai)	(Kgal)		(Kgal)	(Kgal)	(Kgal)	(Kgal)	Update
	GOLDID	10	410		41-SX TANK			44	1 444	275	06/20/04
SX-101 SX-102	SOUND SOUND	IS IS	419 341	0	43 36	0	33 98	44 36	144 55	275 286	06/30/04 08/31/04
SX-102 SX-103	SOUND	IS	509	0	40	0	134	40	78	431	09/30/03
SX-103	ASMD LKR	IS	446	0	48	0	231	48	136	310	04/30/00
SX-105	SOUND	IS	375	0	39	0	153	39	63	312	12/31/02
SX-106	SOUND	IS	396	0	37	0	148	37	0	396	01/31/03
SX-107	ASMDLKR	IS	94	0	7	0	0	7	94	0	07/01/04
SX-108	ASMD LKR	IS	74	0	0	0	0	0	74	0	06/30/04
SX-109	ASMD LKR	IS	241	0	0	0	0	0	66	175	07/01/04
SX-110	ASMD LKR	IS	56	0	0	0	0	0	49 98	7 17	07/01/04 07/01/04
SX-111 SX-112	ASMD LKR ASMD LKR	IS IS	115 75	0	11	0	0	11	75	0	07/01/04
SX-112 SX-113	ASMD LKR	IS	19	0	0	0	0	0	19	0	01/01/02
SX-113	ASMD LKR	IS	155	0	30	0	0	30	126	29	07/01/04
SX-115	ASMD LKR	IS	4	0	0	0	0	0	4	0	.01/01/02
15 TANK	S - TOTAL		3319						1081	2238	
					241-T TANK F	ARM STA	TUS				
T-101	ASMD LKR	IS	99	0	16	0	25	16	37	62	06/30/04
T-102	SOUND	IS	32	13	3	0	0	16	19	0	08/31/84
T-103	ASMD LKR	IS	27	4	3	0	0	7	23	0	11/29/83
T-104	SOUND	IS	317	0	31	0	150	31	317	0	11/30/99
T-105	SOUND	IS	98	0	5	0	0	5	98	0	05/29/87
T-106	ASMD LKR	IS	22	0	0	0	0	. 0	22	0	01/01/01
T-107	ASMD LKR	IS	173	0	34 4	0	11 0	34 4	173 5	0 11	05/31/96 01/01/01
T-108 T-109	ASMD LKR ASMD LKR	IS IS	16 62	0	11	0	0	11	0	62	01/01/01
T-110	SOUND	IS	370	1	48	0	50	49	369	0	03/31/02
	ASMD LKR	IS	447	0	38	0	10	38	447	0	01/01/02
T-112	SOUND	IS	67	7	4	0	0	11	60	0	04/28/82
T-201	SOUND	IS	30	2	4	0	0	6	28	0	07/01/04
T-202	SOUND	IS	20	0	3	0	0	3	20	0	07/01/04
T-203	SOUND	IS	36	0	5	0	0	5	36	0	07/01/04
T-204	SOUND	IS	36	0	5	0	0	5	36	0	07/01/04
16 TANK	S - TOTAL		1852						1690	135	
				_	41-TX TANK F			_ (1	
TX-101	SOUND	IS	91	0	7	0	0	7	74	17	01/01/02
TX-102	SOUND	IS	217	0	27 18	0	94 68	27	2	215 145	03/31/03 01/01/02
TX-103 TX-104	SOUND SOUND	IS IS	145 69	0 2	18	0	4	18 11	34	33	06/30/04
TX-104	ASMD LKR	IS	576	0	25	0	122	25	8	568	01/01/02
TX-106	SOUND	IS	348	0	37	0	135	37	5	343	03/31/02
1	ASMD LKR	IS	29	0	7	0	0	7	0	29	01/31/03
TX-108	SOUND	IS	127	0	8	0	14	8	6	121	06/30/04
TX-109	SOUND	IS	363	0	6	0	72	6	363	0	01/01/02
	ASMD LKR	IS	467	0	14	0	115	14	37	430	01/01/02
TX-111	SOUND	IS	364	0	10	0	98	10	43	321	06/30/04
TX-112	SOUND	IS	634	0	26	0	94	26	0	634	01/01/02
	ASMD LKR	IS IS	638 532	0	18 17	0	19 104	18 17	93 4	545 528	06/30/04 01/01/02
	ASMD LKR ASMD LKR	IS	553	0	25	0	99	25	8	545	06/30/04
	ASMD LKR	IS	599	0	21	0	24	21	66	533	04/30/03
	ASMD LKR	IS	480	0	10	0	54	10	29	451	06/30/04
TX-118	SOUND	IS	247	0	31	0	89	31	0	247	06/30/04
18 TANKS			6479				-		772	5705	

Table 4-1. Inventory and Status by Tank - Single-Shell Tanks (sheet 4 of 4).

All volume data obtained from Tank Waste Information Network System (TWINS)											
	Waste Volumes										
<u> </u>				Super-	Drainable	Pumped		Drainable			
			Total	natant	Interstitial	this	Total	Liquid		Salt-	Solids
Tank	Tank	Tank	Waste	Liquid	Liquid			Remaining	Shidae	cake	Volume
	Integrity	Status	(Kgal)	_	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	(Kgal)	Update
Number	miegrity	Status	(IXgai)					(IXgai)	(Kgai)	(Itgai)	Opuate
TTV 101	ACMADINA	TC	110	24 0	11-TY TANK F. 2		<u>'US</u> 8	2	72	47	01/31/03
TY-101	ASMD LKR	IS	119		_	D O	7	2	0	69	01/31/03
TY-102	SOUND	IS	69	0	13	0		13		51	06/30/04
1	ASMD LKR	IS	154	0	23	0	12	23	103		03/31/02
TY-104	ASMD LKR	IS	44	1	4	0	0	5	43	0	
TY-105	ASMD LKR	IS	231	0	12	0	4	12	231	0	04/28/82
TY-106	ASMD LKR	IS	16	0	1	0	0	1	16	0	01/01/02
6 TANKS	- TOTALS		633						465	167	
				-	41-U TANK FA		_			. 1	
ı	ASMD LKR	IS	23	0	4	0	0	4	23	0	06/30/04
U-102	SOUND	IS	327	1	37	0	87	38	43	283	12/31/02
U-103	SOUND	IS(4)	417	1	33	0	99	34	12	404	06/30/04
U-104	ASMD LKR	IS	122	0	0	0	0	0	122	0	01/01/02
U-105	SOUND	IS	353	0	44	0	88	44	32	321	03/30/01
U-106	SOUND	IS	170	2	36	0	39	39	0	168	06/30/04
U-107	SOUND	IS	294	0	32	0	135	0	15	279	12/31/03
U-108	SOUND	IS	434	0	46	0	115	46	29	405	09/30/04
U-109	SOUND	IS(4)	401	0	47	0	78	47	35	366	04/30/02
U-110	ASMD LKR	IS	176	0	16	0	0	16	176	0	01/01/02
U-111	SOUND	IS	222	0	31	0	85	31	26	196	08/31/03
U-112	ASMD LKR	IS	45	0	4	0	0	4	45	0	02/10/84
U-201	SOUND	IS	4	1	1	0	0	2	3	0	06/30/03
U-202	SOUND	IS	4	1	0	0	0.	1	3	0	06/30/03
U-203	SOUND	IS	3	1	0	0	0	1	2	0	06/30/03
U-204	SOUND	IS	3	1	0	0	0	1	2	0	06/30/03
16 TANKS	S - TOTALS		2998						568	2422	

Note: +/- 1 Kgal difference in volumes is due to rounding.

Footnote:

- (1) C-106: Volumes: Total waste 2771 gallons, liquids 85 gallons, per RPP-19866, Rev. 1, "Calculation for the Post-Retrieval Waste Volume Determination for Tank 241-C-106," dated February 26, 2004.
- (2) C-202: Volumes: Total waste 490 gallons, and sludge 490 gallons
- (3) Hanford Federal Facility Agreement and Consent Order (signed August 2004) modified Milestone M-45-00C (Change Order M-45-04-01) changed the regulatory requirements for retrieval of waste in tanks S-103, S-105, and S-106. "Retrieval" status in these tanks is thereby rescinded.
- (4) Tank A-101 contains retained gas in saltcake; tanks S-102, S-111, U-103, and U-109 contain retained gas in saltcake and sludge.

Table 4-2. Single-Shell Tanks Interim Stabilization Status (Sheet 1 of 2).

Tank Number Number Date (1)		1 4010 7-2.			IIII Stauli	IZanon Status	S (Sheet 1 of 2	
Number Integrity Date (1) Method Number Integrity Date (1) Method A-101 SOUND 11/03 JET (16) BY-107 ASMD LKR 07/79 JET A-102 SOUND 08/89 SN BY-108 ASMD LKR 02/85 JET A-103 ASMD LKR 06/88 AR BY-109 SOUND 07/97 JET A-104 ASMD LKR 07/79 AR BY-110 SOUND 01/85 JET A-105 ASMD LKR 07/79 AR BY-111 SOUND 01/85 JET A-106 SOUND 08/82 AR BY-112 SOUND 01/85 JET A-106 SOUND 08/82 AR BY-112 SOUND 06/84 JET AX-101 SOUND 06/03 JET (9) C-101 ASMD LKR 11/83 AR AX-102 ASMD LKR 09/88 SN C-102 SOUND 09/95 JET (2) AX-103 SOUND 08/87 AR C-103 SOUND 09/95 JET (2) AX-104 ASMD LKR 08/81 AR C-104 SOUND 09/95 SN AR B-101 ASMD LKR 03/81 SN C-105 SOUND 09/95 AR B-102 SOUND 08/85 SN C-106 SOUND 09/95 AR B-103 ASMD LKR 03/81 SN C-105 SOUND 09/95 JET (2) ASMD LKR 03/81 SN C-106 SOUND 09/95 JET AX-103 ASMD LKR 03/85 SN C-106 SOUND 09/95 JET AX-103 ASMD LKR 03/85 SN C-106 SOUND 09/95 JET AX-104 ASMD LKR 03/85 SN C-106 SOUND 09/95 JET AX-105 ASMD LKR 03/85 SN C-106 SOUND 09/95 JET AX-105 ASMD LKR 03/85 SN C-106 SOUND 03/84 AR B-105 ASMD LKR 03/85 SN C-108 SOUND 03/84 AR B-105 ASMD LKR 03/85 SN C-108 SOUND 03/84 AR B-106 SOUND 03/85 SN C-110 ASMD LKR 03/84 AR B-107 ASMD LKR 03/85 SN C-110 ASMD LKR 03/85 SN C-110 ASMD LKR 03/85 AR C-109 SOUND 03/84 AR B-107 ASMD LKR 03/85 SN C-110 ASMD LKR 03/84 AR B-107 ASMD LKR 03/85 SN C-110 ASMD LKR 03/84 AR B-111 ASMD LKR 03/85 SN C-111 ASMD LKR 03/82 AR B-111 ASMD LKR 03/85 SN C-201 ASMD LKR 03/82 AR B-111 ASMD LKR 03/85 SN C-204 ASMD LKR 03/82 AR B-111 ASMD LKR 03/85 SN C-204 ASMD LKR 03/82 AR B-202 SOU			Interim	Interim			Interim	Interim
A-101 SOUND 11/03 JET (16) BY-107 ASMD LKR 07/79 JET	Tank	Tank	Stabilization	Stabilization	1	1		Stabilization
A-102 SOUND	Number	Integrity	Date (1)	Method	Number	Integrity		Method
A-103	A-101	SOUND	11/03	JET (16)	BY-107	ASMD LKR	07/79	JET
A-104	A-102	SOUND	08/89	SN	BY-108	ASMD LKR	02/85	JET
A-105	A-103	ASMD LKR	06/88	AR	BY-109	SOUND	07/97	JET
A-105	A-104	ASMD LKR	09/78	AR (3)	BY-110	SOUND	01/85	JET
A-106 SOUND O8/82 AR BY-112 SOUND O6/84 JET							01/85	
AX-101 SOUND 06/03 JET (9) C-101 ASMD LKR 11/83 AR AX-102 ASMD LKR 09/88 SN C-102 SOUND 09/95 JET (2) AX-103 SOUND 08/87 AR C-103 SOUND 07/03 JET (11) AX-104 ASMD LKR 08/81 AR C-104 SOUND 09/95 SN B-101 ASMD LKR 03/81 SN C-105 SOUND 10/95 AR B-102 SOUND 08/85 SN C-106 SOUND SOUND 09/95 JET ASMD LKR 02/85 SN C-106 SOUND 09/95 JET SOUND 06/85 SN C-106 SOUND 09/95 JET SOUND 06/85 SN C-107 SOUND 09/95 JET SOUND 06/85 SN C-108 SOUND 03/84 AR B-105 ASMD LKR 12/84 AR C-109 SOUND 11/83 AR B-106 SOUND 03/85 SN C-110 ASMD LKR 05/95 JET B-107 ASMD LKR 03/85 SN C-111 ASMD LKR 03/84 SN B-108 SOUND 05/85 SN C-111 ASMD LKR 03/84 SN B-109 SOUND 04/85 SN C-111 ASMD LKR 03/82 AR B-110 ASMD LKR 12/84 AR C-202 ASMD LKR 03/82 AR B-111 ASMD LKR 06/85 SN C-201 ASMD LKR 03/82 AR B-111 ASMD LKR 06/85 SN C-203 ASMD LKR 03/82 AR B-112 ASMD LKR 06/85 SN C-204 ASMD LKR 03/82 AR B-201 ASMD LKR 06/85 SN C-204 ASMD LKR 03/82 AR B-201 ASMD LKR 06/84 AR S-103 SOUND D1/03 JET (18) B-202 SOUND 05/85 AR (2) S-102 SOUND D1/03 JET (18) B-204 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-104 ASMD LKR 06/01 JET B-204 ASMD LKR 06/84 AR S-105 SOUND 06/03 JET (13) BX-104 SOUND 03/81 SN S-106 SOUND 04/00 JET BX-103 SOUND 03/81 SN S-106 SOUND 04/00 JET BX-105 SOUND 03/81 SN S-106 SOUND 04/00 JET BX-105 SOUND 03/81 SN S-106 SOUND 04/01 JET BX-106 SOUND 03/81 SN S-110 SOUND 04/03 JET (13) BX-106 SOUND 03/81 SN S-110 SOUND 04/03 JET (14) BX-107 SOUND 08/03 JET (14) BX-110 ASMD LKR 03/								
AX-102 ASMD LKR 09/88 SN C-102 SOUND 09/95 JET (2) AX-103 SOUND 08/87 AR C-103 SOUND 07/03 JET (11) AX-104 ASMD LKR 08/81 AR C-104 SOUND 09/89 SN B-101 ASMD LKR 03/81 SN C-105 SOUND 10/95 AR B-102 SOUND 08/85 SN C-106 SOUND 10/95 AR B-103 ASMD LKR 02/85 SN C-107 SOUND 09/95 JET B-104 SOUND 06/85 SN C-108 SOUND 03/84 AR B-105 ASMD LKR 12/84 AR C-109 SOUND 11/83 AR B-106 SOUND 03/85 SN C-110 ASMD LKR 05/95 JET B-107 ASMD LKR 03/85 SN C-111 ASMD LKR 03/84 SN B-109								
AX-103 SOUND 08/87 AR C-103 SOUND 07/03 JET (11)								
AX-104 ASMD LKR 08/81 AR C-104 SOUND 09/89 SN								
B-101 ASMD LKR 03/81 SN C-105 SOUND 10/95 AR B-102 SOUND 08/85 SN C-106 SOUND Retrieval Completed 12/31/03 B-103 ASMD LKR 02/85 SN C-107 SOUND 09/95 JET B-104 SOUND 06/85 SN C-109 SOUND 03/84 AR B-105 ASMD LKR 12/84 AR C-109 SOUND 11/83 AR B-106 SOUND 03/85 SN C-110 ASMD LKR 05/95 JET B-107 ASMD LKR 03/85 SN C-111 ASMD LKR 03/84 SN B-108 SOUND 05/85 SN C-112 SOUND 09/90 AR B-109 SOUND 04/85 SN C-201 ASMD LKR 03/82 AR B-110 ASMD LKR 06/85 SN C-203 ASMD LKR 08/81 AR B-111 <t< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></t<>								
B-102 SOUND 08/85 SN C-106 SOUND Retrieval Completed 12/31/03 B-103 ASMD LKR 02/85 SN C-107 SOUND 09/95 JET B-104 SOUND 06/85 SN C-108 SOUND 03/84 AR B-105 ASMD LKR 12/84 AR C-109 SOUND 11/83 AR B-106 SOUND 03/85 SN C-110 ASMD LKR 05/95 JET B-107 ASMD LKR 03/85 SN C-111 ASMD LKR 03/84 SN B-108 SOUND 05/85 SN C-112 SOUND 09/90 AR B-109 SOUND 04/85 SN C-201 ASMD LKR 03/82 AR B-110 ASMD LKR 12/84 AR C-202 ASMD LKR 03/82 AR B-111 ASMD LKR 06/85 SN C-203 ASMD LKR 03/82 AR B-201								
B-103 ASMD LKR 02/85 SN C-107 SOUND 09/95 JET B-104 SOUND 06/85 SN C-108 SOUND 03/84 AR B-105 ASMD LKR 12/84 AR C-109 SOUND 11/83 AR B-106 SOUND 03/85 SN C-110 ASMD LKR 05/95 JET B-107 ASMD LKR 03/85 SN C-111 ASMD LKR 03/84 SN B-108 SOUND 05/85 SN C-112 SOUND 09/90 AR B-108 SOUND 04/85 SN C-201 ASMD LKR 03/82 AR B-109 SOUND 04/85 SN C-201 ASMD LKR 03/82 AR B-110 ASMD LKR 06/85 SN C-202 ASMD LKR 08/81 AR B-111 ASMD LKR 06/85 SN C-203 ASMD LKR 09/82 AR B-201								
B-104 SOUND 06/85 SN C-108 SOUND 03/84 AR B-105 ASMD LKR 12/84 AR C-109 SOUND 11/83 AR B-106 SOUND 03/85 SN C-110 ASMD LKR 05/95 JET B-107 ASMD LKR 03/85 SN C-111 ASMD LKR 03/84 SN B-108 SOUND 05/85 SN C-201 ASMD LKR 03/82 AR B-109 SOUND 04/85 SN C-201 ASMD LKR 03/82 AR B-109 SOUND 04/85 SN C-201 ASMD LKR 03/82 AR B-110 ASMD LKR 12/84 AR C-202 ASMD LKR 03/82 AR B-111 ASMD LKR 06/85 SN C-203 ASMD LKR 03/82 AR B-201 ASMD LKR 05/85 SN C-204 ASMD LKR 09/82 AR B-202								·
B-105 ASMD LKR 12/84 AR C-109 SOUND 11/83 AR B-106 SOUND 03/85 SN C-110 ASMD LKR 05/95 JET B-107 ASMD LKR 03/85 SN C-111 ASMD LKR 03/84 SN B-108 SOUND 05/85 SN C-112 SOUND 09/90 AR B-109 SOUND 04/85 SN C-201 ASMD LKR 03/82 AR B-110 ASMD LKR 12/84 AR C-202 ASMD LKR 08/81 AR B-111 ASMD LKR 06/85 SN C-203 ASMD LKR 03/82 AR B-112 ASMD LKR 06/85 SN C-204 ASMD LKR 09/82 AR B-201 ASMD LKR 08/81 AR (3) S-101 SOUND 12/03 JET (18) B-202 SOUND 05/85 AR (2) S-102 SOUND In Retrieval process B-203 </td <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td> <td></td>								
B-106 SOUND 03/85 SN C-110 ASMD LKR 05/95 JET B-107 ASMD LKR 03/85 SN C-111 ASMD LKR 03/84 SN B-108 SOUND 05/85 SN C-112 SOUND 09/90 AR B-109 SOUND 04/85 SN C-201 ASMD LKR 03/82 AR B-110 ASMD LKR 12/84 AR C-202 ASMD LKR 08/81 AR B-111 ASMD LKR 06/85 SN C-203 ASMD LKR 03/82 AR B-112 ASMD LKR 06/85 SN C-204 ASMD LKR 09/82 AR B-112 ASMD LKR 05/85 SN C-204 ASMD LKR 09/82 AR B-201 ASMD LKR 08/81 AR (3) S-101 SOUND 12/03 JET (18) B-202 SOUND 05/85 AR (2) S-102 SOUND In Retrieval process B-20								
B-107 ASMD LKR 03/85 SN C-111 ASMD LKR 03/84 SN B-108 SOUND 05/85 SN C-112 SOUND 09/90 AR B-109 SOUND 04/85 SN C-201 ASMD LKR 03/82 AR B-110 ASMD LKR 12/84 AR C-202 ASMD LKR 08/81 AR B-111 ASMD LKR 06/85 SN C-203 ASMD LKR 03/82 AR B-112 ASMD LKR 06/85 SN C-204 ASMD LKR 09/82 AR B-201 ASMD LKR 08/81 AR (3) S-101 SOUND 12/03 JET (18) B-202 SOUND 05/85 AR (2) S-102 SOUND In Retrieval process B-203 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-104 ASMD LKR 12/84 AR BX-1								
B-108 SOUND 05/85 SN C-112 SOUND 09/90 AR B-109 SOUND 04/85 SN C-201 ASMD LKR 03/82 AR B-110 ASMD LKR 12/84 AR C-202 ASMD LKR 08/81 AR B-111 ASMD LKR 06/85 SN C-203 ASMD LKR 03/82 AR B-112 ASMD LKR 05/85 SN C-204 ASMD LKR 09/82 AR B-201 ASMD LKR 08/81 AR (3) S-101 SOUND 12/03 JET (18) B-202 SOUND 05/85 AR (2) S-102 SOUND In Retrieval process B-203 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-103 SOUND 09/88 JET BX-101 ASMD LKR 09/78 AR (3) S-105 SOUND 09/88 JET BX-								
B-109 SOUND 04/85 SN C-201 ASMD LKR 03/82 AR B-110 ASMD LKR 12/84 AR C-202 ASMD LKR 08/81 AR B-111 ASMD LKR 06/85 SN C-203 ASMD LKR 03/82 AR B-112 ASMD LKR 05/85 SN C-204 ASMD LKR 09/82 AR B-201 ASMD LKR 08/81 AR (3) S-101 SOUND 12/03 JET (18) B-202 SOUND 05/85 AR (2) S-102 SOUND In Retrieval process B-203 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET BX-101 ASMD LKR 06/84 AR S-104 ASMD LKR 12/84 AR BX-101 ASMD LKR 09/78 AR (3) S-105 SOUND 09/88 JET								
B-110 ASMD LKR 12/84 AR C-202 ASMD LKR 08/81 AR B-111 ASMD LKR 06/85 SN C-203 ASMD LKR 03/82 AR B-112 ASMD LKR 05/85 SN C-204 ASMD LKR 09/82 AR B-201 ASMD LKR 08/81 AR (3) S-101 SOUND 12/03 JET (18) B-202 SOUND 05/85 AR (2) S-102 SOUND In Retrieval process B-203 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-104 ASMD LKR 12/84 AR BX-101 ASMD LKR 09/78 AR (3) S-105 SOUND 09/88 JET BX-102 ASMD LKR 11/78 AR S-106 SOUND 02/01 JET								
B-111 ASMD LKR 06/85 SN C-203 ASMD LKR 03/82 AR B-112 ASMD LKR 05/85 SN C-204 ASMD LKR 09/82 AR B-201 ASMD LKR 08/81 AR (3) S-101 SOUND 12/03 JET (18) B-202 SOUND 05/85 AR (2) S-102 SOUND In Retrieval process B-203 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-104 ASMD LKR 12/84 AR BX-101 ASMD LKR 09/78 AR (3) S-105 SOUND 09/88 JET BX-102 ASMD LKR 11/78 AR S-106 SOUND 02/01 JET BX-103 SOUND 11/83 AR (2) (3) S-107 SOUND 08/03 JET (13) <tr< td=""><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></tr<>								
B-112 ASMD LKR 05/85 SN C-204 ASMD LKR 09/82 AR B-201 ASMD LKR 08/81 AR (3) S-101 SOUND 12/03 JET (18) B-202 SOUND 05/85 AR (2) S-102 SOUND In Retrieval process B-203 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-104 ASMD LKR 12/84 AR BX-101 ASMD LKR 09/78 AR (3) S-105 SOUND 09/88 JET BX-102 ASMD LKR 11/78 AR S-106 SOUND 09/88 JET BX-103 SOUND 11/83 AR (2) (3) S-107 SOUND 08/03 JET (13) BX-104 SOUND 09/89 SN S-108 SOUND 06/01 JET								
B-201 ASMD LKR 08/81 AR (3) S-101 SOUND 12/03 JET (18) B-202 SOUND 05/85 AR (2) S-102 SOUND In Retrieval process B-203 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-104 ASMD LKR 12/84 AR BX-101 ASMD LKR 09/78 AR (3) S-105 SOUND 09/88 JET BX-102 ASMD LKR 11/78 AR S-106 SOUND 09/88 JET BX-103 SOUND 11/83 AR (2) (3) S-107 SOUND 08/03 JET (13) BX-104 SOUND 09/89 SN S-108 SOUND 12/96 JET BX-105 SOUND 03/81 SN S-109 SOUND 06/01 JET BX-106 SOUND 07/95 SN S-110 SOUND 01/97 JET								
B-202 SOUND 05/85 AR (2) S-102 SOUND In Retrieval process B-203 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-104 ASMD LKR 12/84 AR BX-101 ASMD LKR 09/78 AR (3) S-105 SOUND 09/88 JET BX-102 ASMD LKR 11/78 AR S-106 SOUND 09/88 JET BX-103 SOUND 11/83 AR (2) (3) S-107 SOUND 08/03 JET (13) BX-103 SOUND 09/89 SN S-108 SOUND 08/03 JET (13) BX-104 SOUND 09/89 SN S-108 SOUND 12/96 JET BX-105 SOUND 03/81 SN S-109 SOUND 06/01 JET BX-106 SOUND 07/95 SN S-110 SOUND 01/97 JET BX								
B-203 ASMD LKR 06/84 AR S-103 SOUND 04/00 JET B-204 ASMD LKR 06/84 AR S-104 ASMD LKR 12/84 AR BX-101 ASMD LKR 09/78 AR (3) S-105 SOUND 09/88 JET BX-102 ASMD LKR 11/78 AR S-106 SOUND 02/01 JET BX-103 SOUND 11/83 AR (2) (3) S-107 SOUND 08/03 JET (13) BX-103 SOUND 09/89 SN S-108 SOUND 08/03 JET (13) BX-104 SOUND 09/89 SN S-108 SOUND 12/96 JET BX-105 SOUND 03/81 SN S-109 SOUND 06/01 JET BX-106 SOUND 07/95 SN S-110 SOUND 01/97 JET BX-107 SOUND 09/90 JET S-111 SOUND 12/03 Jet (17)								
B-204 ASMD LKR 06/84 AR S-104 ASMD LKR 12/84 AR BX-101 ASMD LKR 09/78 AR (3) S-105 SOUND 09/88 JET BX-102 ASMD LKR 11/78 AR S-106 SOUND 02/01 JET BX-103 SOUND 11/83 AR (2) (3) S-107 SOUND 08/03 JET (13) BX-104 SOUND 09/89 SN S-108 SOUND 12/96 JET BX-105 SOUND 03/81 SN S-109 SOUND 06/01 JET BX-106 SOUND 07/95 SN S-110 SOUND 01/97 JET BX-107 SOUND 09/90 JET S-111 SOUND 12/03 Jet (17) BX-108 ASMD LKR 07/79 SN S-112 SOUND Retrieval in progress BX-109 SOUND 08/90 JET SX-101 SOUND 08/03 JET (14)								
BX-101 ASMD LKR 09/78 AR (3) S-105 SOUND 09/88 JET BX-102 ASMD LKR 11/78 AR S-106 SOUND 02/01 JET BX-103 SOUND 11/83 AR (2) (3) S-107 SOUND 08/03 JET (13) BX-104 SOUND 09/89 SN S-108 SOUND 12/96 JET BX-105 SOUND 03/81 SN S-109 SOUND 06/01 JET BX-106 SOUND 07/95 SN S-110 SOUND 01/97 JET BX-107 SOUND 09/90 JET S-111 SOUND 12/03 Jet (17) BX-108 ASMD LKR 07/79 SN S-112 SOUND Retrieval in progress BX-109 SOUND 08/90 JET SX-101 SOUND 08/03 JET (12) BX-110 ASMD LKR 08/85 SN SX-102 SOUND 08/03 JET (14)								
BX-102 ASMD LKR 11/78 AR S-106 SOUND 02/01 JET BX-103 SOUND 11/83 AR (2) (3) S-107 SOUND 08/03 JET (13) BX-104 SOUND 09/89 SN S-108 SOUND 12/96 JET BX-105 SOUND 03/81 SN S-109 SOUND 06/01 JET BX-106 SOUND 07/95 SN S-110 SOUND 01/97 JET BX-107 SOUND 09/90 JET S-111 SOUND 12/03 Jet (17) BX-108 ASMD LKR 07/79 SN S-112 SOUND Retrieval in progress BX-109 SOUND 08/90 JET SX-101 SOUND 08/03 JET (12) BX-110 ASMD LKR 08/85 SN SX-102 SOUND 08/03 JET (14) BX-111 ASMD LKR 03/95 JET SX-103 SOUND 05/03 JET (8)								
BX-103 SOUND 11/83 AR (2) (3) S-107 SOUND 08/03 JET (13) BX-104 SOUND 09/89 SN S-108 SOUND 12/96 JET BX-105 SOUND 03/81 SN S-109 SOUND 06/01 JET BX-106 SOUND 07/95 SN S-110 SOUND 01/97 JET BX-107 SOUND 09/90 JET S-111 SOUND 12/03 Jet (17) BX-108 ASMD LKR 07/79 SN S-112 SOUND Retrieval in progress BX-109 SOUND 08/90 JET SX-101 SOUND 08/03 JET (12) BX-110 ASMD LKR 08/85 SN SX-102 SOUND 08/03 JET (14) BX-111 ASMD LKR 03/95 JET SX-103 SOUND 05/03 JET (8)								
BX-104 SOUND 09/89 SN S-108 SOUND 12/96 JET BX-105 SOUND 03/81 SN S-109 SOUND 06/01 JET BX-106 SOUND 07/95 SN S-110 SOUND 01/97 JET BX-107 SOUND 09/90 JET S-111 SOUND 12/03 Jet (17) BX-108 ASMD LKR 07/79 SN S-112 SOUND Retrieval in progress BX-109 SOUND 08/90 JET SX-101 SOUND 08/03 JET (12) BX-110 ASMD LKR 08/85 SN SX-102 SOUND 08/03 JET (14) BX-111 ASMD LKR 03/95 JET SX-103 SOUND 05/03 JET (8)								
BX-105 SOUND 03/81 SN S-109 SOUND 06/01 JET BX-106 SOUND 07/95 SN S-110 SOUND 01/97 JET BX-107 SOUND 09/90 JET S-111 SOUND 12/03 Jet (17) BX-108 ASMD LKR 07/79 SN S-112 SOUND Retrieval in progress BX-109 SOUND 08/90 JET SX-101 SOUND 08/03 JET (12) BX-110 ASMD LKR 08/85 SN SX-102 SOUND 08/03 JET (14) BX-111 ASMD LKR 03/95 JET SX-103 SOUND 05/03 JET (8)								
BX-106 SOUND 07/95 SN S-110 SOUND 01/97 JET BX-107 SOUND 09/90 JET S-111 SOUND 12/03 Jet (17) BX-108 ASMD LKR 07/79 SN S-112 SOUND Retrieval in progress BX-109 SOUND 08/90 JET SX-101 SOUND 08/03 JET (12) BX-110 ASMD LKR 08/85 SN SX-102 SOUND 08/03 JET (14) BX-111 ASMD LKR 03/95 JET SX-103 SOUND 05/03 JET (8)								
BX-107 SOUND 09/90 JET S-111 SOUND 12/03 Jet (17) BX-108 ASMD LKR 07/79 SN S-112 SOUND Retrieval in progress BX-109 SOUND 08/90 JET SX-101 SOUND 08/03 JET (12) BX-110 ASMD LKR 08/85 SN SX-102 SOUND 08/03 JET (14) BX-111 ASMD LKR 03/95 JET SX-103 SOUND 05/03 JET (8)								
BX-108 ASMD LKR 07/79 SN S-112 SOUND Retrieval in progress BX-109 SOUND 08/90 JET SX-101 SOUND 08/03 JET (12) BX-110 ASMD LKR 08/85 SN SX-102 SOUND 08/03 JET (14) BX-111 ASMD LKR 03/95 JET SX-103 SOUND 05/03 JET (8)								
BX-109 SOUND 08/90 JET SX-101 SOUND 08/03 JET (12) BX-110 ASMD LKR 08/85 SN SX-102 SOUND 08/03 JET (14) BX-111 ASMD LKR 03/95 JET SX-103 SOUND 05/03 JET (8)								
BX-110 ASMD LKR 08/85 SN SX-102 SOUND 08/03 JET (14) BX-111 ASMD LKR 03/95 JET SX-103 SOUND 05/03 JET (8)	BX-108			SN			Retrieval i	n progress
BX-111 ASMD LKR 03/95 JET SX-103 SOUND 05/03 JET (8)	BX-109	SOUND				SOUND	08/03	JET (12)
	BX-110	ASMD LKR	08/85	SN	SX-102	SOUND	08/03	JET (14)
BY-112 SOLIND 09/90 IET SX-104 ASMD LKR 04/00 IET	BX-111	ASMD LKR	03/95	JET	SX-103	SOUND	05/03	JET (8)
BA-112 SOCIAD SAID SET SA-104 NONE EACH 04/00 SET	BX-112	SOUND	09/90	JET	SX-104	ASMD LKR	04/00	JET
BY-101 SOUND 05/84 JET SX-105 SOUND 08/02 JET (6)	BY-101	SOUND	05/84	JET	SX-105	SOUND	08/02	JET (6)
BY-102 SOUND 04/95 JET SX-106 SOUND 05/00 JET	BY-102	SOUND	04/95	JET	SX-106	SOUND	05/00	JET
BY-103 ASMD LKR 11/97 JET (2) SX-107 ASMD LKR 10/79 AR	BY-103	ASMD LKR	11/97	JET (2)	SX-107	ASMD LKR	10/79	AR
BY-104 SOUND 01/85 JET SX-108 ASMD LKR 08/79 AR	BY-104	SOUND	01/85		SX-108	ASMD LKR	08/79	AR
BY-105 ASMD LKR 03/03 JET SX-109 ASMD LKR 05/81 AR	BY-105	ASMD LKR	03/03	JET	SX-109	ASMD LKR	05/81	AR
BY-106 ASMD LKR 12/03 JET (19) SX-110 ASMD LKR 08/79 AR				JET (19)				

Table 4-2. Single-Shell Tanks Interim Stabilization Status (Sheet 2 of 2).

Tank Tank Stabilization Stabilization Date (1) Date (1) Date (1) Method Number Integrity Date (1) Method Number Integrity Date (1) Method SX-111 ASMD LKR 07/79 SN TX-111 SOUND 04/83 JET		1 auto 4-2.	Single-Shell	Tanks Hitch	III Staviii	zation Status	(Blicci Z UI Z	·)·
Number Integrity Date (1) Method Number Integrity Date (1) Method SX-111 ASMD LKR 07/79 SN TX-111 SOUND 04/83 JET SX-112 ASMD LKR 07/79 AR TX-112 SOUND 04/83 JET SX-113 ASMD LKR 11/78 AR TX-114 ASMD LKR 04/83 JET SX-114 ASMD LKR 07/79 AR TX-114 ASMD LKR 04/83 JET SX-115 ASMD LKR 09/78 AR (3) TX-115 ASMD LKR 04/83 JET T-101 ASMD LKR 04/93 SN TX-116 ASMD LKR 04/83 JET T-102 SOUND 03/81 AR (2)(3) TX-117 ASMD LKR 04/83 JET T-104 SOUND 01/97 JET TY-101 ASMD LKR 04/83 JET T-105 SOUND 01/97 AR TY-102 SOUND 09/79 <t< td=""><td></td><td></td><td>Interim</td><td>Interim</td><td></td><td></td><td>Interim</td><td>Interim</td></t<>			Interim	Interim			Interim	Interim
SX-111 ASMD LKR 07/79 SN TX-111 SOUND 04/83 JET SX-112 ASMD LKR 07/79 AR TX-112 SOUND 04/83 JET SX-113 ASMD LKR 11/78 AR TX-113 ASMD LKR 04/83 JET SX-114 ASMD LKR 09/79 AR TX-114 ASMD LKR 04/83 JET SX-115 ASMD LKR 09/78 AR (3) TX-116 ASMD LKR 04/83 JET T-101 ASMD LKR 04/93 SN TX-116 ASMD LKR 04/83 JET T-102 SOUND 03/81 AR (2)(3) TX-117 ASMD LKR 03/83 JET T-102 SOUND 03/81 AR (2)(3) TX-117 ASMD LKR 03/83 JET T-102 SOUND 06/87 AR TX-118 SOUND 04/83 JET T-105 SOUND 06/87 AR TY-102 SOUND 09/79 AR </td <td>1</td> <td></td> <td>Stabilization</td> <td></td> <td>1</td> <td>I</td> <td>Stabilization</td> <td></td>	1		Stabilization		1	I	Stabilization	
SX-112 ASMD LKR 07/79 AR TX-112 SOUND 04/83 JET SX-113 ASMD LKR 11/78 AR TX-113 ASMD LKR 04/83 JET SX-114 ASMD LKR 07/79 AR TX-114 ASMD LKR 04/83 JET SX-115 ASMD LKR 09/78 AR (3) TX-115 ASMD LKR 04/83 JET T-101 ASMD LKR 04/93 SN TX-116 ASMD LKR 04/83 JET T-102 SOUND 03/81 AR (2)(3) TX-117 ASMD LKR 03/83 JET T-103 ASMD LKR 11/83 AR TX-118 SOUND 04/83 JET T-104 SOUND 06/87 AR TY-101 ASMD LKR 04/83 JET T-104 SOUND 06/87 AR TY-102 SOUND 09/79 AR T-106 ASMD LKR 08/81 AR TY-102 SOUND 09/79 AR	Number							
SX-113 ASMD LKR 11/78 AR TX-113 ASMD LKR 04/83 JET SX-114 ASMD LKR 07/79 AR TX-114 ASMD LKR 04/83 JET SX-115 ASMD LKR 09/78 AR (3) TX-115 ASMD LKR 09/83 JET T-101 ASMD LKR 04/93 SN TX-116 ASMD LKR 04/83 JET T-102 SOUND 03/81 AR (2)(3) TX-116 ASMD LKR 03/83 JET T-103 ASMD LKR 11/83 AR TX-118 SOUND 04/83 JET T-104 SOUND 11/99 JET TY-101 ASMD LKR 04/83 JET T-105 SOUND 06/87 AR TY-102 SOUND 09/79 AR T-105 SOUND 06/87 AR TY-102 SOUND 09/79 AR T-105 ASMD LKR 08/81 AR TY-102 SOUND C9/83 JET <	SX-111	ASMD LKR	07/79	SN	TX-111	SOUND	04/83	JET
SX-114 ASMD LKR 07/79 AR TX-114 ASMD LKR 04/83 JET SX-115 ASMD LKR 09/78 AR (3) TX-115 ASMD LKR 09/83 JET T-101 ASMD LKR 04/93 SN TX-116 ASMD LKR 04/83 JET T-102 SOUND 03/81 AR (2)(3) TX-117 ASMD LKR 03/83 JET T-103 ASMD LKR 11/83 AR TX-118 SOUND 04/83 JET T-104 SOUND 11/99 JET TY-101 ASMD LKR 04/83 JET T-105 SOUND 06/87 AR TY-102 SOUND 09/79 AR T-106 ASMD LKR 08/81 AR TY-102 SOUND 09/79 AR T-107 ASMD LKR 08/81 AR TY-104 ASMD LKR 02/83 JET T-107 ASMD LKR 11/78 AR TY-104 ASMD LKR 02/83 JET	SX-112	ASMD LKR	07/79	AR	TX-112	SOUND	04/83	JET
SX-115 ASMD LKR 09/78 AR (3) TX-115 ASMD LKR 09/83 JET T-101 ASMD LKR 04/93 SN TX-116 ASMD LKR 04/83 JET T-102 SOUND 03/81 AR (2)(3) TX-117 ASMD LKR 03/83 JET T-103 ASMD LKR 11/83 AR TX-118 SOUND 04/83 JET T-104 SOUND 11/99 JET TY-101 ASMD LKR 04/83 JET T-105 SOUND 06/87 AR TY-102 SOUND 09/79 AR T-106 ASMD LKR 08/81 AR TY-103 ASMD LKR 02/83 JET T-107 ASMD LKR 05/96 AR TY-104 ASMD LKR 02/83 JET T-108 ASMD LKR 11/78 AR TY-105 ASMD LKR 01/83 JET T-109 ASMD LKR 11/78 AR TY-104 ASMD LKR 11/78 AR <td>SX-113</td> <td>ASMD LKR</td> <td>11/78</td> <td>AR</td> <td>TX-113</td> <td>ASMD LKR</td> <td>04/83</td> <td>JET</td>	SX-113	ASMD LKR	11/78	AR	TX-113	ASMD LKR	04/83	JET
T-101 ASMD LKR 04/93 SN TX-116 ASMD LKR 04/83 JET T-102 SOUND 03/81 AR (2)(3) TX-117 ASMD LKR 03/83 JET T-103 ASMD LKR 11/83 AR TX-118 SOUND 04/83 JET T-104 SOUND 11/99 JET TY-101 ASMD LKR 04/83 JET T-105 SOUND 06/87 AR TY-102 SOUND 09/79 AR T-106 ASMD LKR 08/81 AR TY-102 SOUND 09/79 AR T-106 ASMD LKR 08/81 AR TY-104 ASMD LKR 02/83 JET T-107 ASMD LKR 05/96 AR TY-104 ASMD LKR 02/83 JET T-108 ASMD LKR 11/78 AR TY-105 ASMD LKR 02/83 JET T-109 ASMD LKR 12/84 AR TY-106 ASMD LKR 11/78 AR <tr< td=""><td>SX-114</td><td>ASMD LKR</td><td>07/79</td><td>AR</td><td>TX-114</td><td>ASMD LKR</td><td>04/83</td><td>JET</td></tr<>	SX-114	ASMD LKR	07/79	AR	TX-114	ASMD LKR	04/83	JET
T-102 SOUND 03/81 AR (2)(3) TX-117 ASMD LKR 03/83 JET T-103 ASMD LKR 11/83 AR TX-118 SOUND 04/83 JET T-104 SOUND 11/99 JET TY-101 ASMD LKR 04/83 JET T-105 SOUND 06/87 AR TY-102 SOUND 09/79 AR T-106 ASMD LKR 08/81 AR TY-102 SOUND 09/79 AR T-106 ASMD LKR 08/81 AR TY-103 ASMD LKR 02/83 JET T-107 ASMD LKR 05/96 AR TY-104 ASND LKR 11/78 AR T-108 ASMD LKR 11/78 AR TY-105 ASMD LKR 02/83 JET T-109 ASMD LKR 12/84 AR TY-106 ASMD LKR 02/83 JET T-110 SOUND 01/00 JET U-101 ASMD LKR 10/79 AR	SX-115	ASMD LKR	09/78	AR (3)	TX-115	ASMD LKR	09/83	
T-103 ASMD LKR 11/83 AR TX-118 SOUND 04/83 JET T-104 SOUND 11/99 JET TY-101 ASMD LKR 04/83 JET T-105 SOUND 06/87 AR TY-102 SOUND 09/79 AR T-106 ASMD LKR 08/81 AR TY-103 ASMD LKR 02/83 JET T-107 ASMD LKR 05/96 AR TY-104 ASND KJR 11/83 AR T-108 ASMD LKR 11/78 AR TY-105 ASMD LKR 02/83 JET T-109 ASMD LKR 11/78 AR TY-105 ASMD LKR 02/83 JET T-109 ASMD LKR 11/78 AR TY-106 ASMD LKR 02/83 JET T-109 ASMD LKR 11/78 AR TY-106 ASMD LKR 09/79 AR T-110 SOUND 01/00 JET U-101 ASMD LKR 10/79 AR		ASMD LKR	04/93	SN		ASMD LKR	04/83	JET
T-104 SOUND 11/99 JET TY-101 ASMD LKR 04/83 JET T-105 SOUND 06/87 AR TY-102 SOUND 09/79 AR T-106 ASMD LKR 08/81 AR TY-103 ASMD LKR 02/83 JET T-107 ASMD LKR 05/96 AR TY-104 ASND KJR 11/83 AR T-108 ASMD LKR 11/78 AR TY-105 ASMD LKR 02/83 JET T-109 ASMD LKR 11/78 AR TY-105 ASMD LKR 02/83 JET T-109 ASMD LKR 11/78 AR TY-105 ASMD LKR 02/83 JET T-109 ASMD LKR 12/84 AR TY-106 ASMD LKR 11/78 AR T-110 SOUND 01/00 JET U-101 ASMD LKR 19/79 AR T-111 ASMD LKR 02/95 JET U-102 SOUND 06/02 JET (5)	T-102	SOUND		AR (2)(3)		ASMD LKR		
T-105 SOUND 06/87 AR TY-102 SOUND 09/79 AR T-106 ASMD LKR 08/81 AR TY-103 ASMD LKR 02/83 JET T-107 ASMD LKR 05/96 AR TY-104 ASND KJR 11/83 AR T-108 ASMD LKR 11/78 AR TY-105 ASMD LKR 02/83 JET T-109 ASMD LKR 12/84 AR TY-106 ASMD LKR 11/78 AR T-110 SOUND 01/00 JET U-101 ASMD LKR 09/79 AR T-110 SOUND 01/00 JET U-101 ASMD LKR 09/79 AR T-111 ASMD LKR 02/95 JET U-102 SOUND 06/02 JET (5) T-112 SOUND 03/81 AR (2)(3) U-103 SOUND 09/00 JET T-201 SOUND 04/81 AR (2)(3) U-103 SOUND 03/01 JET	T-103	ASMD LKR	11/83	AR		SOUND	04/83	JET
T-106 ASMD LKR 08/81 AR TY-103 ASMD LKR 02/83 JET T-107 ASMD LKR 05/96 AR TY-104 ASND KJR 11/83 AR T-108 ASMD LKR 11/78 AR TY-105 ASMD LKR 02/83 JET T-109 ASMD LKR 12/84 AR TY-106 ASMD LKR 11/78 AR T-110 SOUND 01/00 JET U-101 ASMD LKR 09/79 AR T-110 SOUND 01/00 JET U-102 SOUND 06/02 JET (5) T-111 ASMD LKR 02/95 JET U-102 SOUND 06/02 JET (5) T-112 SOUND 03/81 AR (2)(3) U-103 SOUND 09/00 JET T-201 SOUND 04/81 AR (2)(3) U-103 SOUND 09/00 JET T-202 SOUND 04/81 AR U-105 SOUND 03/01 JET	T-104	SOUND	11/99	JET	TY-101	ASMD LKR	04/83	JET
T-107 ASMD LKR 05/96 AR TY-104 ASND KJR 11/83 AR T-108 ASMD LKR 11/78 AR TY-105 ASMD LKR 02/83 JET T-109 ASMD LKR 12/84 AR TY-106 ASMD LKR 11/78 AR T-110 SOUND 01/00 JET U-101 ASMD LKR 09/79 AR T-111 ASMD LKR 02/95 JET U-102 SOUND 06/02 JET (5) T-112 SOUND 03/81 AR (2)(3) U-103 SOUND 09/00 JET T-112 SOUND 03/81 AR (3) U-103 SOUND 09/00 JET T-201 SOUND 04/81 AR (3) U-104 ASMD LKR 10/78 AR T-202 SOUND 08/81 AR U-105 SOUND 03/01 JET T-203 SOUND 04/81 AR U-106 SOUND 03/01 JET (15)	T-105	SOUND	06/87	AR		SOUND	09/79	
T-108 ASMD LKR 11/78 AR TY-105 ASMD LKR 02/83 JET T-109 ASMD LKR 12/84 AR TY-106 ASMD LKR 11/78 AR T-110 SOUND 01/00 JET U-101 ASMD LKR 09/79 AR T-111 ASMD LKR 02/95 JET U-102 SOUND 06/02 JET (5) T-112 SOUND 03/81 AR (2)(3) U-103 SOUND 09/00 JET (5) T-201 SOUND 03/81 AR (2)(3) U-103 SOUND 09/00 JET T-201 SOUND 04/81 AR (3) U-104 ASMD LKR 10/78 AR T-202 SOUND 08/81 AR U-105 SOUND 03/01 JET T-203 SOUND 04/81 AR U-106 SOUND 03/01 JET T-204 SOUND 08/81 AR U-107 SOUND 03/04 (20)	T-106	ASMD LKR	08/81		TY-103		02/83	JET
T-109 ASMD LKR 12/84 AR TY-106 ASMD LKR 11/78 AR T-110 SOUND 01/00 JET U-101 ASMD LKR 09/79 AR T-111 ASMD LKR 02/95 JET U-102 SOUND 06/02 JET (5) T-112 SOUND 03/81 AR (2)(3) U-103 SOUND 09/00 JET T-201 SOUND 04/81 AR (3) U-104 ASMD LKR 10/78 AR T-202 SOUND 04/81 AR U-105 SOUND 03/01 JET T-203 SOUND 04/81 AR U-106 SOUND 03/01 JET T-204 SOUND 08/81 AR U-107 SOUND 03/01 JET (15) TX-101 SOUND 08/81 AR U-107 SOUND 03/04 (20) TX-102 SOUND 04/83 JET U-108 SOUND 03/04 (20) TX-	T-107	ASMD LKR	05/96	AR	TY-104	ASND KJR	11/83	AR
T-110 SOUND 01/00 JET U-101 ASMD LKR 09/79 AR T-111 ASMD LKR 02/95 JET U-102 SOUND 06/02 JET (5) T-112 SOUND 03/81 AR (2)(3) U-103 SOUND 09/00 JET T-201 SOUND 04/81 AR (3) U-104 ASMD LKR 10/78 AR T-202 SOUND 08/81 AR U-105 SOUND 03/01 JET T-203 SOUND 04/81 AR U-106 SOUND 03/01 JET T-204 SOUND 08/81 AR U-106 SOUND 03/01 JET TX-101 SOUND 08/81 AR U-107 SOUND 03/04 (20) TX-101 SOUND 04/83 JET U-108 SOUND 03/04 (20) TX-102 SOUND 04/83 JET U-109 SOUND 04/02 JET (4) TX-103 </td <td>T-108</td> <td>ASMD LKR</td> <td>11/78</td> <td>AR</td> <td>TY-105</td> <td>ASMD LKR</td> <td>02/83</td> <td>JET</td>	T-108	ASMD LKR	11/78	AR	TY-105	ASMD LKR	02/83	JET
T-111 ASMD LKR 02/95 JET U-102 SOUND 06/02 JET (5) T-112 SOUND 03/81 AR (2)(3) U-103 SOUND 09/00 JET T-201 SOUND 04/81 AR (3) U-104 ASMD LKR 10/78 AR T-202 SOUND 08/81 AR U-105 SOUND 03/01 JET T-203 SOUND 04/81 AR U-106 SOUND 03/01 JET T-204 SOUND 08/81 AR U-107 SOUND 03/01 JET TX-101 SOUND 08/81 AR U-107 SOUND 03/04 (20) TX-101 SOUND 02/84 AR U-108 SOUND 03/04 (20) TX-102 SOUND 04/83 JET U-109 SOUND 04/02 JET (4) TX-103 SOUND 08/83 JET U-110 ASMD LKR 12/84 AR TX-104 </td <td>T-109</td> <td>ASMD LKR</td> <td>12/84</td> <td>AR</td> <td>TY-106</td> <td>ASMD LKR</td> <td>11/78</td> <td>AR</td>	T-109	ASMD LKR	12/84	AR	TY-106	ASMD LKR	11/78	AR
T-112 SOUND 03/81 AR (2)(3) U-103 SOUND 09/00 JET T-201 SOUND 04/81 AR (3) U-104 ASMD LKR 10/78 AR T-202 SOUND 08/81 AR U-105 SOUND 03/01 JET T-203 SOUND 04/81 AR U-106 SOUND 03/01 JET T-204 SOUND 08/81 AR U-107 SOUND 10/03 JET (15) TX-101 SOUND 08/81 AR U-108 SOUND 03/04 (20) TX-101 SOUND 04/83 JET U-108 SOUND 03/04 (20) TX-102 SOUND 04/83 JET U-109 SOUND 04/02 JET (4) TX-103 SOUND 08/83 JET U-110 ASMD LKR 12/84 AR TX-104 SOUND 09/79 SN U-111 SOUND 06/03 JET (10) TX-1	T-110	SOUND	01/00	JET	U-101	ASMD LKR	09/79	AR
T-201 SOUND 04/81 AR (3) U-104 ASMD LKR 10/78 AR T-202 SOUND 08/81 AR U-105 SOUND 03/01 JET T-203 SOUND 04/81 AR U-106 SOUND 03/01 JET T-204 SOUND 08/81 AR U-107 SOUND 10/03 JET (15) TX-101 SOUND 02/84 AR U-108 SOUND 03/04 (20) TX-102 SOUND 04/83 JET U-109 SOUND 04/02 JET (4) TX-103 SOUND 08/83 JET U-110 ASMD LKR 12/84 AR TX-104 SOUND 09/79 SN U-111 SOUND 06/03 JET (10) TX-105 ASMD LKR 04/83 JET U-112 ASMD LKR 09/79 AR TX-106 SOUND 06/83 JET U-201 SOUND 08/79 SN TX-108	T-111	ASMD LKR	02/95	JET	U-102	SOUND	06/02	JET (5)
T-201 SOUND 04/81 AR (3) U-104 ASMD LKR 10/78 AR T-202 SOUND 08/81 AR U-105 SOUND 03/01 JET T-203 SOUND 04/81 AR U-106 SOUND 03/01 JET T-204 SOUND 08/81 AR U-107 SOUND 10/03 JET (15) TX-101 SOUND 02/84 AR U-108 SOUND 03/04 (20) TX-101 SOUND 04/83 JET U-108 SOUND 03/04 (20) TX-102 SOUND 04/83 JET U-109 SOUND 04/02 JET (4) TX-103 SOUND 08/83 JET U-110 ASMD LKR 12/84 AR TX-104 SOUND 09/79 SN U-111 SOUND 06/03 JET (10) TX-105 ASMD LKR 04/83 JET U-201 SOUND 08/79 AR TX-106<	T-112	SOUND	03/81	AR (2)(3)	U-103	SOUND	09/00	JET
T-203 SOUND 04/81 AR U-106 SOUND 03/01 JET T-204 SOUND 08/81 AR U-107 SOUND 10/03 JET (15) TX-101 SOUND 02/84 AR U-108 SOUND 03/04 (20) TX-102 SOUND 04/83 JET U-109 SOUND 04/02 JET (4) TX-103 SOUND 08/83 JET U-110 ASMD LKR 12/84 AR TX-104 SOUND 09/79 SN U-111 SOUND 06/03 JET (10) TX-105 ASMD LKR 04/83 JET U-112 ASMD LKR 09/79 AR TX-106 SOUND 06/83 JET U-201 SOUND 08/79 AR TX-107 ASMD LKR 10/79 AR U-202 SOUND 08/79 SN TX-108 SOUND 03/83 JET U-203 SOUND 08/79 SN TX-109 </td <td>T-201</td> <td>SOUND</td> <td>04/81</td> <td>AR (3)</td> <td>U-104</td> <td>ASMD LKR</td> <td>10/78</td> <td>AR</td>	T-201	SOUND	04/81	AR (3)	U-104	ASMD LKR	10/78	AR
T-204 SOUND 08/81 AR U-107 SOUND 10/03 JET (15) TX-101 SOUND 02/84 AR U-108 SOUND 03/04 (20) TX-102 SOUND 04/83 JET U-109 SOUND 04/02 JET (4) TX-103 SOUND 08/83 JET U-110 ASMD LKR 12/84 AR TX-104 SOUND 09/79 SN U-111 SOUND 06/03 JET (10) TX-105 ASMD LKR 04/83 JET U-112 ASMD LKR 09/79 AR TX-106 SOUND 06/83 JET U-201 SOUND 08/79 AR TX-107 ASMD LKR 10/79 AR U-202 SOUND 08/79 SN TX-108 SOUND 03/83 JET U-203 SOUND 08/79 SN TX-109 SOUND 04/83 JET U-204 SOUND 08/79 SN	T-202	SOUND	08/81	AR	U-105	SOUND	03/01	JET ·
TX-101 SOUND 02/84 AR U-108 SOUND 03/04 (20) TX-102 SOUND 04/83 JET U-109 SOUND 04/02 JET (4) TX-103 SOUND 08/83 JET U-110 ASMD LKR 12/84 AR TX-104 SOUND 09/79 SN U-111 SOUND 06/03 JET (10) TX-105 ASMD LKR 04/83 JET U-112 ASMD LKR 09/79 AR TX-106 SOUND 06/83 JET U-201 SOUND 08/79 AR TX-107 ASMD LKR 10/79 AR U-202 SOUND 08/79 SN TX-108 SOUND 03/83 JET U-203 SOUND 08/79 SN TX-109 SOUND 04/83 JET U-204 SOUND 08/79 SN	T-203	SOUND	04/81	AR	U-106	SOUND	03/01	JET
TX-102 SOUND 04/83 JET U-109 SOUND 04/02 JET (4) TX-103 SOUND 08/83 JET U-110 ASMD LKR 12/84 AR TX-104 SOUND 09/79 SN U-111 SOUND 06/03 JET (10) TX-105 ASMD LKR 04/83 JET U-112 ASMD LKR 09/79 AR TX-106 SOUND 06/83 JET U-201 SOUND 08/79 AR TX-107 ASMD LKR 10/79 AR U-202 SOUND 08/79 SN TX-108 SOUND 03/83 JET U-203 SOUND 08/79 SN TX-109 SOUND 04/83 JET U-204 SOUND 08/79 SN	T-204	SOUND	08/81	AR	U-107	SOUND	10/03	JET (15)
TX-103 SOUND 08/83 JET U-110 ASMD LKR 12/84 AR TX-104 SOUND 09/79 SN U-111 SOUND 06/03 JET (10) TX-105 ASMD LKR 04/83 JET U-112 ASMD LKR 09/79 AR TX-106 SOUND 06/83 JET U-201 SOUND 08/79 AR TX-107 ASMD LKR 10/79 AR U-202 SOUND 08/79 SN TX-108 SOUND 03/83 JET U-203 SOUND 08/79 SN TX-109 SOUND 04/83 JET U-204 SOUND 08/79 SN	TX-101	SOUND	02/84	AR	U-108	SOUND	03/04	(20)
TX-104 SOUND 09/79 SN U-111 SOUND 06/03 JET (10) TX-105 ASMD LKR 04/83 JET U-112 ASMD LKR 09/79 AR TX-106 SOUND 06/83 JET U-201 SOUND 08/79 AR TX-107 ASMD LKR 10/79 AR U-202 SOUND 08/79 SN TX-108 SOUND 03/83 JET U-203 SOUND 08/79 SN TX-109 SOUND 04/83 JET U-204 SOUND 08/79 SN	TX-102	SOUND	04/83	JET	U-109	SOUND	04/02	JET (4)
TX-105 ASMD LKR 04/83 JET U-112 ASMD LKR 09/79 AR TX-106 SOUND 06/83 JET U-201 SOUND 08/79 AR TX-107 ASMD LKR 10/79 AR U-202 SOUND 08/79 SN TX-108 SOUND 03/83 JET U-203 SOUND 08/79 AR TX-109 SOUND 04/83 JET U-204 SOUND 08/79 SN	TX-103	SOUND	08/83	JET	U-110	ASMD LKR	12/84	AR
TX-105 ASMD LKR 04/83 JET U-112 ASMD LKR 09/79 AR TX-106 SOUND 06/83 JET U-201 SOUND 08/79 AR TX-107 ASMD LKR 10/79 AR U-202 SOUND 08/79 SN TX-108 SOUND 03/83 JET U-203 SOUND 08/79 AR TX-109 SOUND 04/83 JET U-204 SOUND 08/79 SN	TX-104	SOUND	09/79	SN	U-111	SOUND	06/03	JET (10)
TX-107 ASMD LKR 10/79 AR U-202 SOUND 08/79 SN TX-108 SOUND 03/83 JET U-203 SOUND 08/79 AR TX-109 SOUND 04/83 JET U-204 SOUND 08/79 SN	TX-105	ASMD LKR	04/83	JET	U-112	ASMD LKR	09/79	
TX-107 ASMD LKR 10/79 AR U-202 SOUND 08/79 SN TX-108 SOUND 03/83 JET U-203 SOUND 08/79 AR TX-109 SOUND 04/83 JET U-204 SOUND 08/79 SN	TX-106	SOUND	06/83	JET	U-201	SOUND	08/79	AR
TX-108 SOUND 03/83 JET U-203 SOUND 08/79 AR TX-109 SOUND 04/83 JET U-204 SOUND 08/79 SN	TX-107	ASMD LKR	10/79	AR	U-202	SOUND	08/79	
TX-109 SOUND 04/83 JET U-204 SOUND 08/79 SN	TX-108	SOUND	03/83	JET	U-203	SOUND		
	TX-109	SOUND	04/83	JET	U-204			
	TX-110	ASMD LKR	04/83	JET				

LEGEND:			
AR	Administratively Interim Stabilized	Interim Stabilized Tanks	149
JET	Saltwell Jet Pumped to Remove Drainable Interstitial Liquid	Total Single-Shell Tanks	149
SN	Supernatant Pumped (Non-Jet Pumped)		
ASMD LKR	Assumed Leaker		
N/A	Not yet Interim Stabilized		

Table 4-2. - Footnotes: (in chronological order)

- (1) These dates indicate when the tanks were actually interim stabilized. In some cases, the official interim stabilization documents were issued at a later date.
- (2) Although tanks 241-BX-103, T-102, and T-112 met the interim stabilization administrative procedure at the time they were stabilized, they no longer meet the updated administrative procedure. The tanks were re-evaluated in 1996 and a letter was issued to DOE-RL recommending that no further pumping be performed on these tanks, based on an economic evaluation. In February 2000, it was determined that five tanks no longer met the stabilization criteria (241-

Table 4-2. - Footnotes continued

BX-103, T-102, and T-112 exceed the supernatant criteria, and BY-103 and C-102 exceed the Drainable Interstitial Liquid [DIL]criteria).

An intrusion investigation was completed on tank 241-B-202 in 1996 and it was determined that this tank no longer meets the recently updated administrative procedure for 200 series tanks.

- Original interim stabilization data are missing on four tanks: 241-B-201, T-102, T-112, and T-201. In February 2001, three additional tanks were added to those missing stabilization data: 241-A-104, BX-101, and SX-115.
- (4) Tank 241-U-109 was declared Interim Stabilized on April 5, 2002. The declaration letter to DOE was issued on June 20, 2002. The surface is primarily a brown colored waste with irregular patches of white salt crystal. Approximately 70% of the waste surface is covered by the salt formations. The waste surface appears dry and shows signs of cracking due to saltwell pumping. There is no visible liquid within the tank.
- Tank 241-U-102 was declared Interim Stabilized on June 19, 2002. The declaration letter to DOE was issued June 28, 2002. The surface is primarily a gray-brown colored cracked waste with irregular patches of white salt crystal. Approximately 50% of the waste surface is covered by the salt formations. The waste surface appears dry and shows signs of cracking due to saltwell pumping. There is approximately a 5-foot wide pool of visible liquid within the saltwell screen depression.
- (6) Tank 241-SX-105 was declared Interim Stabilized on August 1, 2002; the declaration letter to DOE was issued August 20, 2002. The surface is a rough, yellowish-gray saltcake waste with an irregular surface of visible cracks and shelves due to saltwell pumping. The waste surface appears to be dry and shows no standing water within the tank.
- Tank 241-BY-105 was declared Interim Stabilized on March 7, 2003; the declaration letter to DOE was issued March 25, 2003. An in-tank video was taken January 5, 2003. The surface is a rough, yellowish brown saltcake waste with an irregular surface of visible lumps and shelves that were created as the surface was dried out by saltwell pumping. The waste surface appears to be dry and shows no standing water within the tank. A large hole around the saltwell screen shows no evidence of supernatant liquid.
- (8) Tank 241-SX-103 was declared Interim Stabilized on May 31, 2003; the declaration letter to DOE was issued June 13, 2003. An in-tank video was taken December 31, 2001. The upper waste surface is uneven and rough, with many cracks and shelves due to surface drying caused by saltwell pumping. All estimations regarding waste dimensions were obtained by comparison with known dimensions of installed in-tank equipment.
- (9) Tank 241-AX-101 was declared Interim Stabilized on June 2, 2003. The declaration letter to DOE was issued January 19, 2004. An in-tank video was taken November 5, 2003. The surface is a dry flaky, crystalline, yellowish-white saltcake waste in a fairly uniform surface of large cracks that were created as the surface dried out by saltwell pumping. The surface is dry and shows no standing water in the tank.
- (10) Tank 241-U-111 was declared Interim Stabilized on June 25, 2003, due to major equipment failure; the declaration letter to DOE was issued July 14, 2003. An in-tank video was taken March 25, 2003. The surface is a dry, crusty, flat surface saltcake waste with a fairly uniform surface of large cracks and pocked holes that were created as the surface was dried out by saltwell pumping. The waste surface is dry and shows no standing water.
- (11) Tank 241-C-103 was declared Interim Stabilized on July 11, 2003, due to major equipment failure; the declaration letter to DOE was issued August 13, 2003. An in-tank video was taken March 3, 2003. The surface is a dry-cracked brown sludge type waste, which appears to be relatively level and to have more cracking near the tank walls. There is a roughly 3-foot diameter supernatant pool around the saltwell screen. There are also small supernatant pools around two risers and many liquid pockets across the center waste surface. The ENRAF is out of service and there is no liquid observation well (LOW) installed in the tank.
- Tank 241-SX-101 was declared Interim Stabilized on August 14, 2003; the declaration letter to DOE was issued August 22, 2003. An in-tank video was taken August 6, 2003. The surface is a rough, yellowish gray saltcake waste with an irregular surface of visible cracks and shelves that were created as the waste was dried out by saltwell pumping. The waste surface appears to be dry and shows no standing water. A cylindrical pool (approximately 5 foot diameter) around the saltwell screen shows evidence of apparent supernatant liquid, but upon closer examination, was determined to be interstitial liquid.

Table 4-2. - Footnotes continued

- Tank 241-S-107 was declared Interim Stabilized on August 28, 2003, due to major equipment failure. Interim Stabilization documentation was issued February 4, 2004; the declaration letter to DOE was issued February 26, 2004. An in-tank video was taken December 12, 2003. The waste appears as a flat, dark, sludge-type waste with an irregular surface of visible cracks created as the waste dried out from saltwell pumping. The waste surface appears to be dry except for a small pool surrounding the saltwell screen.
- (14) Tank 241-SX-102 was declared Interim Stabilized on August 28, 2003, due to major equipment failure. The declaration letter to DOE was issued August 4, 2004. An in-tank video was taken December 10, 2003. The waste is a rough, yellowish-tray saltcake with an irregular surface of visible cracks and shelves that were created as the waste was dried out by saltwell pumping. The waste surface appears to be dry and shows no standing water on the surface.
- Tank 241-U-107 was declared Interim Stabilized on October 7, 2003. The declaration letter to DOE was issued January 19, 2004. An in-tank video was taken February 4, 2003. The surface is a smooth, brownish saltcake with irregular patches of white salt crystals created as the waste was dried out from saltwell pumping. The waste surface appears to be dry and shows no standing water on the surface.
- (16) Tank 241-A-101 was declared Interim Stabilized on November 10, 2003. The declaration letter to DOE was issued June 30, 2004. An in-tank video was taken September 5, 2003. The waste appears as a flat, dark, sludge-type waste with an irregular surface with white clumps of a saltcake-type material. Cracks in the waste surface were created as the waste was dried out by saltwell pumping. The waste surface is dry except for a small pool around the saltwell screen.
- (17) Tank 241-S-111 was declared Interim Stabilized on December 15, 2003, due to major equipment failure. This tank is in evaluation to confirm interim stabilization criteria have been met.
- (18) Tank 241-S-101 was declared Interim Stabilized on December 29, 2003. The declaration letter to DOE was issued April 30, 2004. An in-tank video was taken March 2, 2004. The waste appears to be a flat, dark, sludge-type waste with an irregular surface with white clumps of saltcake. Also visible are cracks in the waste surface that were created as the waste was dried out by saltwell pumping. The waste surface is dry except for this small pool.
- (19) Tank BY-106 was declared Interim Stabilized on December 31, 2003. This tank is in evaluation to confirm interim stabilization criteria have been met.
- (20) Tank U-108 was declared Interim Stabilized on March 18, 2004, due to major equipment failure. The declaration letter to DOE was issued September 8, 2004. An in-tank video was taken March 8, 2004. The waste is a smooth, brownish saltcake waste with irregular patches of white salt crystals that were created as the waste was dried out by saltwell pumping. The surface appears to be dry with evidence of cracking and no standing water.

Table 4-3. Single-Shell Tank Interim Stabilization Milestones - Consent Decree.

New single-shell interim stabilization milestones were negotiated in 1999 and are identified in the "Consent

Decree." The Consent Decree was approved on August 16, 1999.

The following is the schedule for pumping liquid waste from the remaining 29 single-shell tanks; this schedule is enforceable pursuant to the Decree except for the "Projected Pumping Completion Dates," which are estimates only. This schedule does not include tank 241-C-106.

	Tank Projected Pumping Actual Pumping Projected Pumping Interim Start Pote Completion Pote Stabilization Pote									
	Designation Start Date Start Date Completion Date Stabilization Da									
1.	241-T-104	Already initiated	March 24, 1996	May 30, 1999	November 19, 1999					
2.	241-T-110	Already initiated	May 12, 1997	May 30, 1999	January 5, 2000					
3.	241-SX-104	Already initiated	September 26, 1997	December 30, 2000	April 26, 2000					
4.	241-SX-106	Already initiated	October 6, 1998	December 30, 2000	May 5, 2000					
5.	241-S-102	Already initiated	March 18, 1999	March 30, 2001	(Retrieval)					
6.	241-S-106	Already initiated	April 16, 1999	March 30, 2001	February 1, 2001					
7.	241-S-103	Already initiated	June 4, 1999	March 30, 2001	April 18, 2000					
8.	241-U-103 *	June 15, 2000	September 26, 1999	April 15, 2002	September 11, 2000					
9.	241-U-105 *	June 15, 2000	December 10, 1999	April 15, 2002	March 29, 2001					
10.	241-U-102 *	June 15, 2000	January 20, 2000	April 15, 2002	June 19, 2002					
11.	241-U-109 *	June 15, 2000	March 11, 2000	April 15, 2002	April 5, 2002					
12.	241-A-101	October 30, 2000	May 6, 2000	September 30, 2003	November 10, 2003					
13.										
14.	241-SX-105	March 15, 2001 August 8, 2000 February 28, 2003 August 1, 2002								
15.	241-SX-103	March 15, 2001 October 26, 2000 February 28, 2003 May 31, 2003								
16.	241-SX-101	March 15, 2001 November 22, 2000 February 28, 2003 August 14, 2003								
17.	241-U-106 *	March 15, 2001	August 24, 2000	February 28, 2003	March 9, 2001					
18.	241-BY-106	July 15, 2001	July 11, 2001	June 30, 2003	December 31, 2003					
19.	241-BY-105	July 15, 2001	July 11, 2001	June 30, 2003	March 7, 2003					
20.	241-U-108	December 30, 2001	December 2, 2001	August 30, 2003	March 18, 2004					
21.	241-U-107	December 30, 2001	September 29, 2001	August 30, 2003	October 7, 2003					
22.	241-S-111	December 30, 2001	December 18, 2001	August 30, 2003	December 15, 2003					
23.	241-SX-102	December 30, 2001	December 15, 2001	August 30, 2003	August 28, 2003					
24.	24. 241-U-111 November 30, 2002 June 14, 2002 September 30, 2003 June 25, 2003									
25.	241-S-109 November 30, 2002 September 23, 2000 September 30, 2003 June 11, 2001									
26.	241-S-112									
27.	241-S-101	November 30, 2002 July 27, 2002 September 30, 2003 December 29, 2003								
28.	241-S-107									
29.	241-C-103									
		ahead of the scheduled start date of April 2003. It is the final tank to begin pumping								
		operations specified in this Decree. Pumping was completed in this tank on March 3, 2003,								
	and a declaration memo that the tank has met interim stabilization criteria was issued on									
		March 7, 2003. This t	tank was declared Inter	im Stabilized on July 11	, 2003.					

^{*} Tanks containing organic complexants.

<u>Completion of Interim Stabilization</u>. DOE will complete interim stabilization of all 29 single-shell tanks listed above by September 30, 2004.

Percentage of Pumpable Liquid Remaining to be Removed:

93% of Total Liquid	9/30/1999 (1)
38% of Organic Complexed Pumpable Liquids	9/30/2000 (2)
5% of Organic Complexed Pumpable Liquids	9/30/2001 (3)
18% of Total Liquid	9/30/2002 (4)
2% of Total Liquid	9/30/2003 (5)

The "percentage of pumpable liquid remaining to be removed" is calculated by dividing the volume of pumpable liquid remaining to be removed from tanks not yet interim stabilized by the sum of the total amount of liquid that has been pumped and the pumpable liquid that remains to be pumped from all tanks.

Footnotes:

- (1) The Pumpable Liquid Remaining was reduced to 88% by September 30, 1999. Reference LMHC-9957926 R1, D. I. Allen, LHMC, to D. C. Bryson, DOE-ORP, dated October 26, 1999.
- (2) The Complexed Pumpable Liquid Remaining was reduced to 38% by September 15, 2000. Reference CHG-0004752, R. F. Wood, CHG, to J. J. Short, DOE-ORP, dated September 13, 2000.
- Reference CHG-0104859, R. F. Wood, CHG, to J. S. O'Connor, DOE-ORP, dated September 20, 2001: this reference states that tanks U-102 and U-109 appear to have met the interim stabilization criteria, thereby reducing the Complexed Pumpable Liquid Remaining to zero. Reference CHG-0202630, dated June 20, 2002, declared tank U-109 Interim Stabilized and confirmed the completion of Consent Decree milestone, Attachment A, Item 11, as well as the partial completion of milestone D-001-004-T01. Reference CHG-0202901, dated June 28, declared tank U-102 Interim Stabilized and confirmed the completion of Consent Decree milestone, Attachment A, Item 10, as well as the partial completion of milestone D-001-004-T01.
- (4) The Pumpable Liquid Remaining was reduced to less than 18% of the total liquid by September 30, 2003. Reference CHG-204636, R. F. Wood, CHG, to J. S. O'Connor, DOE-ORP, dated September 30, 2002. The percentage of pumpable liquid remaining was 17.94% or less than 550 Kgallons.
- (5) The Pumpable Liquid Remaining was reduced to 2% of the total liquid by August 31, 2003, approximately 30 days ahead of the required completion date of September 30, 2003. The confirmation letter to DOE-ORP will be issued in September 2003. The volume of pumpable liquid remaining in the non-stabilized tanks is slightly less than 2% of the original total pumpable volume.

Table 4-4. Single-Shell Tank Leak Volume Estimates (Sheet 1 of 2)

Table -	Table 4-4. Single-Shell Tank Leak Volume Estimates (Sheet 1 of 2				Leak Estimate	
			Interim	Dean Estimate		
Tank Number	Assumed Leaker (3)	Gallons (2)	Stabilized (11)	Updated	Reference	
241-A-103	1987	5500 (8)	06/88	1987	(j)	
241-A-104	1975	500 to 2500	09/78	1983	(a)(p)	
241-A-105 (1)	1963	10000 to 270000	07/79	1991	(b)(c)	
241-AX-102	1988	3000 (8)	09/88	1989	(h)	
241-AX-104	1977	(6)	08/81	1989	(g)	
241-B-101	1974	(6)	03/81	1989	(g)	
241-B-103	1978	(6)	02/85	1989	(g)	
241-B-105	1978	(6)	12/84	1989	(g)	
241-B-107	1980	8000 (8)	03/85	1986	(d)(f)	
241-B-110	1981	10000 (8)	03/85	1986	(d)	
241-B-111	1978	(6)	06/85	1989	(g)	
241-B-112	1978	2000	05/85	1989	(g)	
241-B-201	1980	1200 (8)	08/81	1984	(e)(f)	
241-B-203	1983	300 (8)	06/84	1986	(d)	
241-B-204	1984	400 (8)	06/84	1989	(g)	
241-BX-101	1972	(6)	09/78	1989	(g)	
241-BX-102	1971	70000	11/78	1986	(d)	
241-BX-108	1974	2500	07/79	1986	(d)	
241-BX-110	1976	(6)	08/85	1989	(g)	
241-BX-111	1984 (13)	(6)	03/95	1993	(g)	
241-BY-103	1973	<5000	11/97	1983	(a)	
241-BY-105	1984	(6)	03/03	1989	(g)	
241-BY-106	1984	(6)	.N/A	1989	(g)	
241-BY-107	1984	15100 (8)	07/79	1989	(g)	
241-BY-108	1972	<5000	02/85	1983	(a)	
241-C-101	1980	20000 (8)(10)	11/83	1986	(d)	
241-C-110	1984	2000	05/95	1989	(g)	
241-C-111	1968	5500 (8)	03/84	1989	(g)	
241-C-201 (4)	1988	550	03/82	1987	(i)	
241-C-202 (4)	1988	450	08/81	1987	(i)	
241-C-203	1984	400 (8)	03/82	1986	(d)	
241-C-204 (4)	1988	350	09/82	1987	(i)	
241-S-104	1968	24000 (8)	12/84	1989	(g)	
241-SX-104	1988	6000 (8)	04/00	1988	(k)	
241-SX-107	1964	< 5000	10/79	1983	(a)	
241-SX-108 (5)(14)	1962	2400 to 35000	08/79	1991	(1)(p)(s)	
241-SX-109 (5)(14)	1965	<10000	05/81	1992	(m)(s)	
241-SX-110	1976	5500 (8)	08/79	1989	(g)	
241-SX-111 (14)	1974	500 to 2000	07/79	1986	(d)(s)	
241-SX-112 (14)	1969	30000	07/79	1986	(d)(s)	
241-SX-113	1962	15000	11/78	1986	(d)	
241-SX-114	1972	(6)	07/79	1989	(g)	
241-SX-115	1965	50000	09/78	1992	(n)	
241-T-101	1992	7500 (8)	04/93	1992	(0)	
241-T-103	1974	<1000 (8)	11/83	1989	(g)	
241-T-106	1973	115000 (8)	08/81	1986	(d)	

Table 4-4. Single-Shell Tank Leak Volume Estimates (Sheet 2 of 2)

	Estimated Leak			Leak Estimate	
	Confirmed or	Volume	Interim		
Tank Number	Assumed Leaker (3)	Gallons (2)	Stabilized (11)	Updated	Reference
241-T-107	1984	(6)	05/96	1989	(g)
241-T-108	1974	<1000 (8)	11/78	1980	(f)
241-T-109	1974	<1000 (8)	12/84	1989	(g)
241-T-111	1979, 1994 (12)	<1000 (8)	02/95	1994	(f)(r)
241-TX-105	1977	(6)	04/83	1989	(g)
241-TX-107 (5)	1984	2500	10/79	1986	(d)
241-TX-110	1977	(6)	04/83	1989	(g)
241-TX-113	1974	(6)	04/83	1989	(g)
241-TX-114	1974	(6)	04/83	1989	(g)
241-TX-115	1977	(6)	09/83	1989	(g)
241-TX-116	1977	(6)	04/83	1989	(g)
241-TX-117	1977	(6)	03/83	1989	(g)
241-TY-101	·1973	<1000 (8)	04/83	1980	(f)
241-TY-103	1973	3000	02/83	1986	(d)
241-TY-104	1981	1400 (8)	11/83	1986	(d)
241-TY-105	1960	35000	02/83	1986	(d)
241-TY-106	1959	20000	11/78	1986	(d)
241-U-101	1959	30000	09/79	1986	(d)
241-U-104	1961	55000	10/78	1986	(d)
241-U-110	1975	5000 to 8100 (8)	12/84	1986	(d)(p)
241-U-112	1980	8500 (8)	09/79	1986	(d)
67 Tanks		<u> </u>			

Table 4-4. - Footnotes:

- Current estimates [see Reference (b)] are that 610 Kgallons of cooling water was added to tank A-105 from November 1970 to December 1978 to aid in evaporative cooling. In accordance with <u>Dangerous Waste Regulations</u> [Washington Administrative Code 173-303-070 (2)(a)(ii), as amended, Washington State Department of Ecology, 1990, Olympia, Washington], any of this cooling water that has been added and subsequently leaked from the tank must be classified as a waste and should be included in the total leak volume. In August 1991, the leak volume estimate for this tank was updated in accordance with the WAC regulations. Previous estimates excluded the cooling water leaks from the total leak volume estimates because the waste content (concentration) in the cooling water which leaked should be much less than the original liquid waste in the tank (the sludge is relatively insoluble). The total leak volume estimate in this report (10 to 277 Kgallons) is based on the following (see References):
 - a. Reference (b) contains an estimate of 5 to 15 Kgallons for the initial leak prior to August 1968.

Reference (b) contains an estimate of 5 to 30 Kgallons for the leak while the tank was being sluiced from August 1968 to November 1970.

Reference (b) contains an estimate of 610 Kgallons of cooling water added to the tank from November 1970 to December 1978, but it was estimated that the leakage was small during this period. This reference contains the statement "Sufficient heat was generated in the tank to evaporate most, and perhaps nearly all, of this water." This results in a low estimate of zero gallons leakage from November 1970 to December 1978.

b. Reference (c) contains an estimate that 378 to 410 Kgallons evaporated out of the tank from November 1970 to December 1978. Subtracting the minimum evaporation estimate from the cooling water added estimate provides a range from 0 to 232 Kgallons of cooling water leakage from November 1970 to December 1978.

Table 4-4. - Footnotes continued

	Low Estimate	High Estimate
Prior to August 1968	5,000	15,000
August 1968 to November 1970	5,000	30,000
November 1970 to December 1978	0	<u>232,000</u>
Totals	10,000	277,000

- Tank leak volume estimates presented here are being updated as a result of additional vadose zone data, tank leak volume assessments and review of tanks for retrieval/closure consideration. Future revisions of the tank summary report will include updated leak volume and radionuclide inventory estimates by farm and will include near surface and vadose contamination from sources in addition to tank leaks that will be used for tank closure planning and performance assessments. Tank leak volume estimates presented here do not include (with some exceptions), such things as: (a) cooling/raw water leaks, (b) intrusions (rain infiltration) and subsequent leaks, (c) leaks inside the tank farm but not through the tank liner (surface leaks, pipeline leaks, leaks at the joint for the overflow or fill lines, etc.), and (d) leaks from catch tanks, diversion boxes, encasements, etc.
- In many cases, a leak was suspected long before it was identified or confirmed. For example, Reference (d) shows that tank U-104 was suspected of leaking in 1956. The leak was confirmed in 1961. This report lists the "assumed leaker" date of 1961. Using present standards, tank U-104 would have been declared an assumed leaker in 1956. In 1984, the criteria designations of "suspected leaker," "questionable integrity," "confirmed leaker," "declared leaker," and "borderline and dormant" were merged into one category now reported as "assumed leaker." See Reference (f) for explanation of when, how long, and how fast some of the tanks leaked. It is highly likely that there have been undetected leaks from single-shell tanks because of the nature of their design and instrumentation.
- (4) The leak volume estimate date for these tanks is before the declared leaker date because the tank was in a suspected leaker or questionable integrity status; however, a leak volume had been estimated prior to the tank being reclassified.
- The increasing radiation levels in drywells and laterals associated with these three tanks could be indicating continuing leak or movement of existing radionuclides in the soil. There is no conclusive way to confirm these observations. (Repeat spectral drywell scans are not part of the current Tank Farm leak detection program but can be run on request a special needs arise. A select subset of drywells is routinely monitored by the Vadose Zone Characterization Project to assess movement of gamma-emitting radionuclides in the subsurface. There are currently no functioning laterals and no plan to prepare them for use).
- Methods were used to estimate the leak volumes from these 19 tanks based on the <u>assumption</u> that their cumulative leakage is approximately the same as for 18 of the 24 tanks identified in footnote (9). For more details see Reference (g). The total leak volume estimate for these tanks is 150 Kgallons (rounded to the nearest Kgallon), for an average of approximately 8 Kgallons for each of 19 tanks.
- (7) The total has been rounded to the nearest 50 Kgallons. Upper bound values were used in many cases in developing these estimates. It is likely that some of these tanks have not actually leaked.
- (8) Leak volume estimate is based solely on observed liquid level decreases in these tanks. This is considered to be the most accurate method for estimating leak volumes.
- (9) The curie content shown is as listed in the reference document and is <u>not</u> decayed to a consistent date: therefore, a cumulative total is inappropriate.
- Tank C-101 experienced a liquid level decrease in the late 1960s and was taken out of service and pumped to a minimum heel in December 1969. In 1970, the tank was classified as a "questionable integrity" tank. Liquid level data show decreases in level throughout the 1970s and the tank was saltwell pumped during the 1970s, ending in April 1979. The tank was reclassified as a "confirmed leaker" in January 1980. See References (p) and (q); refer to Reference (q) for information on the potential for there to have been leaks from other C-farm tanks (specifically, C-102, C-103, and C-109).
- (11) These dates indicate when the tanks were declared to be interim stabilized. In some cases, the official interim stabilization documents were issued at a later date. Also, in some cases, the field work associated with interim stabilization was completed at an earlier date.

Table 4-4. Footnotes continued

- (12) Tank T-111 was declared an "assumed re-leaker" on February 28, 1994, due to a decreasing trend in surface level measurement. This tank was pumped, and interim stabilization completed on February 22, 1995.
- (13) Tank BX-111 was declared an "assumed re-leaker" in April 1993. Preparations for pumping were delayed, following an administrative hold placed on all tank farm operations in August 1993. Pumping resumed and the tank was declared interim stabilized on March 15, 1995.
- The leak volume and curie release estimates on tanks SX-108, SX-109, SX-111, and SX-112 have been re-evaluated using a Historical Leak Model [see Reference (s)]. In general, the model estimates are much higher than the values listed in the table, both for volume and curies released. The values listed in the table do not reflect this revised estimate because, "In particular, it is worth emphasizing that this report was never meant to be a definitive update for the leak baseline at the Hanford Site. It was rather meant to be an attempt to view the issue of leak inventories with a new and different methodology." (This quote is from the first page of the referenced report).
- (15) Tri-Party Agreement milestones (M-45 series) were developed that establish a formalized approach for evaluating impacts on groundwater quality of loss of tank wastes to the vadose zone underlying these tank farms.

SST Vadose Zone Project drilling and testing activities near tank BX-102 were completed in March 2001. A borehole (299-E33-45) was drilled through the postulated uranium plume resulting from the 1951 tank BX-102 overfill event to confirm the presence of uranium, define its present depth, and survey other contaminants of interest such as Tc-99. Samples were collected for laboratory analyses.

Borehole W33-46, adjacent to tank B-110, was drilled to a depth of approximately 190 feet in July 2001. Soil samples were collected for analysis as part of the tank farm vadose zone characterization activities.

On July 31, 2002, the Washington State Department of Ecology issued a letter-directive which suggested a path forward in dealing with the high ⁹⁹Tc activity in groundwater at well 299-W23-19 near tank SX-115. No formal remediation is required, however, extensive purging of the well is to be done concurrent with quarterly sampling. In addition, an array of specific conductivity probes is to be placed in the well to monitor the electrical properties of the water (⁹⁹Tc activity is directly proportional to electrical conductivity). A data logger with remote reading capability together with the specific conductivity probes was installed and fully operational on March 11, 2003.

Table 4-4. - References:

- (a) Murthy, K. S., et al., June 1983, Assessment of Single-Shell Tank Residual Liquid Issues at Hanford Site, Washington, PNL-4688, Pacific Northwest Laboratory, Richland, Washington.
- (b) WHC, 1991a, Tank 241-A-105 Leak Assessment, WHC-MR-0264, Westinghouse Hanford Company, Richland, Washington.
- (c) WHC, 1991b, Tank 241-A-105 Evaporation Estimate 1970 Through 1978, WHC-EP-0410, Westinghouse Hanford Company, Richland, Washington.
- (d) Smith, D. A., January 1986, Single-Shell Tank Isolation Safety Analysis Report, SD-WM-SAR-006, Rev. 1, Rockwell Hanford Operations, Richland, Washington.
- (e) McCann, D. C., and T. S. Vail, September 1984, Waste Status Summary, RHO-RE-SR-14, Rockwell Hanford Operations, Richland, Washington.
- (f) Catlin, R. J., March 1980, Assessment of the Surveillance Program of the High-Level Waste Storage Tanks at Hanford, Office of Environmental Compliance and Review, for the U.S. Department of Energy, Washington D.C.
- (g) Baurnhardt, R. J., May 15, 1989, Letter to R. E. Gerton, U.S. Department of Energy-Richland Operations Office, Single-Shell Tank Leak Volumes, 8901832B R1, Westinghouse Hanford Company, Richland, Washington.
- (h) WHC, 1990a, Occurrence Report, Surface Level Measurement Decrease in Single-Shell Tank 241-AX-102, WHC-UO-89-023-TF-05, Westinghouse Hanford Company, Richland, Washington.
- Groth, D. R., July 1, 1987, Internal Memorandum to R. J. Baumhardt, Liquid Level Losses in Tanks 241-C-201, -202 and -204, 65950-87-517, Westinghouse Hanford Company, Richland, Washington.
- (j) Groth, D. R., and G. C. Owens, May 15, 1987, Internal Memorandum to J. H. Roecker, Tank 103-A Integrity Evaluation, Rockwell Hanford Operations, Richland, Washington.
- (k) Dunford, G. L., July 8, 1988, Internal Memorandum to R. K. Welty, Engineering Investigation: Interstitial Liquid Level Decrease in Tank 241-SX-104, 13331-88-416, Westinghouse Hanford Company, Richland, Washington.
- WHC, 1992a, Tank 241-SX-108 Leak Assessment, WHC-MR-0300, Westinghouse Hanford Company, Richland, Washington.
- (m) WHC, 1992b, Tank 241-SX-109 Leak Assessment, WHC-MR-0301, Westinghouse Hanford Company, Richland, Washington.
- (n) WHC, 1992c, Tank 241-SX-115 Leak Assessment, WHC-MR-0302, Westinghouse Hanford Company, Richland, Washington.
- (0) WHC, 1992d, Occurrence Report, Apparent Decrease in Liquid Level in Single Shell Underground Storage Tank 241-T-101, Leak Suspected; Investigation Continuing, RL-WHC-TANKFARM-1992-0073, Westinghouse Hanford Company, Richland, Washington.
- (p) WHC,1990b, A History of the 200 Area Tank Farms, WHC-MR-0132, Westinghouse Hanford Company, Richland, Washington.
- (q) WHC, 1993, Assessment of Unsaturated Zone Radionuclide Contamination Around Single-Shell Tanks 241-C-105 and 241-C-106, WHC-SD-EN-TI-185, REV OA, Westinghouse Hanford Company, Richland, Washington.
- (r) WHC, 1994, Occurrence Report, Apparent Liquid Level Decrease in Single Shell Underground Storage Tank 241-T-111; Declared an Assumed Re-Leaker, RL-WHC-TANKFARM-1994-0009, Westinghouse Hanford Company, Richland, Washington.
- (s) HNF, 1998, Agnew, S. F., and R. A. Corbin, August 1998, Analysis of SX Farm Leak Histories Historical Leak Model (HLM), HNF-3233, Rev. 0, Los Alamos National Laboratory, Los Alamos, New Mexico.

5.0 MISCELLANEOUS UNDERGROUND STORAGE TANKS AND SPECIAL SURVEILLANCE FACILITIES

Table 5-1. East and West Area Miscellaneous Underground Storage Tanks and Special Surveillance Facilities.

ACTIV	E - still runnir	ng transfers through t	he associated	diversion boxes or pipelin	ne encasements
		Receives Waste	Waste		
Facility	Location	From:	(Gallons)	Monitored By:	Remarks
EAST AREA					
241-A-302-A	A Farm	A-151 DB	670	SACS/ENRAF/TMACS	
241-ER-311	B Plant	ER-151, ER-152 DB	3761	SACS/ENRAF/Manual	
241-AZ-151	AZ Farm	AZ-702 Condensate	6770	SACS/ENRAF/TMACS	Volume changes daily - pumped to AZ-101 or AY-102 as needed
241-AZ-154	AZ Farm		25	SACS/MT	
244-BX-TK-SMP	BX Complex	DCRT - Receives from several farms	18185	SACS/MT	Receives transfers and is pumped as needed
244-A-TK/SMP	A Complex	DCRT - Receives from several farms	6005	MCS/SACS/WTF	WTF - Receives transfers and is pumped as needed
A-350	A Farm	Collects drainage	556	MCS/SACS/WTF	WTF (uncorrected), pumped as needed
AR-204	AY Farm	Tanker trucks from various facilities	900	DIP TUBE	
A-417	A Farm		1176	SACS/WTF	WTF
CR-003-TK-SMP	C Farm	DCRT	2146	ZIP CORD	Zip cord installed; MT removed; more accurate conversion table used
WEST AREA					
241-TX-302-C	T Plant	TX-154 DB	178	SACS/ENRAF/TMACS	
241-U-301-B	U Farm	U-151, 152, 153, 252 DB	1456	SACS/ENRAF/Manual	Pumped to SY-101, 12/03
241-UX-302-A	U Plant	UX-154	1776	SACS/ENRAF/Manual	Rain intrusion 2/03; recalibration caused decrease 6/03
241-S-304	S Farm	S-151 DB	135	SACS/ENRAF/Manual	Sump not alarming
244-S-TK/SMP	S Farm	From SSTs for transfer to SY-102	8910	SACS/Manual	WTF (uncorrected)
244-TX-TK/SMP	TX Farm	From SSTs and PFP for transfer to SY-102	14602	SACS/Manual	Received from 241-Z, tank D-5, 11/04
Vent Station Catch Tank		Cross Site Transfer Line	500	SACS/Manual	MT. Rain intrusion, 1/03
		Total A	ctive Facilitie	es - 17	

LEGEND:	
DB	Diversion Box
DCRT	Double-Contained Receiver Tank
ENRAF, MT, Zip Cord	Surface Level Measurement Devices
MCS	Monitor and Control System
Manual	Not connected to any automated system
O/S	Out of Service
PFP	Plutonium Finishing Plant
SACS	Surveillance Automated Control System
SST	Single-Shell Tank
TMACS	Tank Monitor and Control System
WTF	Weight Factor (can be recorded as WTF, WTF [uncorrected] or CWF [uncorrected])

Table 5-2. East Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance Facilities.

IN	ACTIVE - No lon	ger receiving waste transfe	rs - currentl	y managed b	y Tank Farm Contractor
Facility	Location	Received Waste From:	Waste (Gallons)	Monitored By:	Remarks
209-E-TK-111	209 E Bldg.	Decon Catch Tank	Unknown	NM	Removed from service 1988
241-A-302-B	A Farm	A-152 DB	6110	SACS/MT	Isolated 1985, Project B-138, Interim Stabilized 1990, rain intrusion
241-AX-151	N. of PUREX	PUREX	Unknown	NM	Isolated 1985
241-AX-152	AX Farm	AX-152 DB	0	SACS/MT	Declared Assumed Leaker, pumped to AY-102, 3/01, no longer being used
241-B-301-B	B Farm	B-151, 152, 153, 252 DB	22250	NM	Isolated 1985 (1)
241-B-302-B	B Farm	B-154 DB	4930	NM	Isolated 1985 (1)
241-BX-302-A	BX Farm	BR-152, BX-153, BXR- 152, BYR-152 DB	840	NM	Isolated 1985 (1)
241-BX-302-B	BX Farm	BX-154 DB	1040	NM	Isolated 1985 (1)
241-BX-302-C	BX Farm	BX-155 DB	870	NM	Isolated 1985 (1)
241-BY-ITS2- TK 1	BY Farm	Vapor condenser	Unknown	NM	Isolated
241-BY-ITS2- TK 2	BY Farm	Heater Flush Tank	Unknown	NM	Stabilized 1977
241-C-301-C	C Farm	C-151, 152, 153, 252 DB	10470	NM	Isolated 1985 (1)
241-ER-311A	SW of B Plant	ER-151 DB	Empty	NM	Abandoned in place 1954
241-AR Vault	A Complex	Between farms and B Plant	Unknown	NM	Stabilized 8/03, RPP-12051
241-BXR- TK/SMP-001	BX Farm	Transfer lines	7200	NM	Interim Stabilization 1985 (1)
241-BXR- TK/SMP-002	BX Farm	Transfer Lines	2180	NM	Interim Stabilization 1985 (1)
241-BXR- FK/SMP-003	BX Farm	Transfer Lines	1810	NM	Interim Stabilization 1985 (1)
241-BXR- FK/SMP-004	BX Farm	Transfer Lines	7100	NM	Interim Stabilization 1985 (1)

LEGEND:	
DB	Diversion Box
MT	Surface Level measurement Device
NM	Not Monitored
SACS	Surveillance Automated Control System
TK, SMP	Tank, Sump

⁽¹⁾ WHC-SD-WM-TI-356, Waste Storage Tank Status and Leak Detection Criteria, Rev. 0, September 30, 1988

Table 5-3. West Area Inactive Miscellaneous Underground Storage Tanks and Special Surveillance Facilities.


INACTI	VE - No longer	receiving waste transfers	- currently m	anaged by Ta	nk Farm Contractor	
			Waste	Monitored		
Facility	Location	Received Waste From:	(Gallons)	By:	Remarks	
213-W-TK-1	E. of 213-W	Water Retention Tank	Unknown	NM	Contains only water	
	Compactor					
	Facility					
231-W-151-001	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974	
231-W-151-002	N. of Z Plant	231-Z Floor drains	Unknown	NM	Inactive, last data 1974	
240-S-302	S Plant	240-S-151-DB	8145		Assumed Leaker, EPDA 85-04	
241-S-302-A	S Farm	241-S-151-DB	0		Assumed Leaker TF-EFS-90-042	
	Partially filled with grout 2/91, determined to be an Assumed Leaker after leak test. No surface level or intrusion readings obtainable. S-304 (active) replaced S-302					
				02	Tx 1: 11005 (1)	
241-S-302-B	SX Farm	S Encasements	Empty	NM	Isolated 1985 (1)	
241-SX-302 (SX-304)	SX Farm	SX-151 DB, 151 TB	Unknown	NM	Isolated 1987	
241-T-301	T Farm	DB T-151, 151, 153, 252	Unknown	NM	Isolated 1985 (T-301-B)	
241-TX-302	TX Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)	
241-TX-302-X-B	TX Farm	TX Encasements	Unknown	NM	Isolated 1985 (1)	
241-TX-302-X-B	E. of TX	TX-155 DB	3253	SACS/	New ENRAF installed 9/02	
241-1A-302-D	Farm	1X-133 DB .	3233	ENRAF	New ENRAI Instance 9/02	
241-TX-302-B(R)	E. of TX	TX-155 DB	Unknown	NM	Isolated, replaced TX-302-B	
241-1X-302-D(K)	Farm	1X-133 DB	Chalown	14141	isolated, replaced TA-502-B	
241-TY-302-A	TY Farm	TX-153 DB	Unknown	NM	Isolated 1985 (1)	
241-TY-302-B	TY Farm	TY Encasements	Empty	NM	Isolated 1985 (1)	
241-Z-8	E. of Z Plant	Recuplex waste	Unknown	NM	Isolated, 1974, 1975	
242-T-135	T Evaporator	T Evaporator	Unknown	NM	Isolated	
242-TA-R1	T Evaporator	Z Plant waste	Unknown	NM	Isolated	
243-S-TK-1	NW of S	Personnel Decon.	Empty	NM	Isolated	
	Farm	Facility				
244-TXR-TK/SMP-	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed	
001		J			1984 (1)	
244-TXR-TK/SMP-	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed	
002					1984 (1)	
244-TXR-TK/SMP-	TX Farm	Transfer lines	Unknown	NM	Interim Stabilized, MT removed	
003					1984 (1)	
244-UR-001 Vault TK	U Farm	Tank, Sump and Cell	4220	NM	Stabilized 1985	
244-UR-002 Vault TK	U Farm	Tank, Sump and Cell	1400	NM	Stabilized 1985	
244-UR-003 Vault TK	U Farm	Tank, Sump and Cell	5996	NM	Stabilized 1985	
244-UR-004 Vault TK	U Farm	Tank, Sump and Cell	Empty	NM	Stabilized 1985	
		Total East Area Inact	ive Facilities -	25		

LEGEND:	
DB, TD	Diversion Box, Transfer Box
FIC, ENRAF	Surface Level Measurement Devices
MT	Manual Tape - Surface Level measurement Device
NM	Not Monitored
SACS	Surveillance Automated Control System
TK, SMP	Tank, Sump
SACS	Surveillance Automated Control System
TK, SMP	Tank, Sump

⁽¹⁾ WHC-SD-WM-TI-356, Waste Storage Tank Status and Leak Detection Criteria, Rev. 0, September 30, 1988

APPENDIX A - TANK CONFIGURATION AND FACILITIES CHARTS

Figure A-1. High Level Waste Tank Configurations

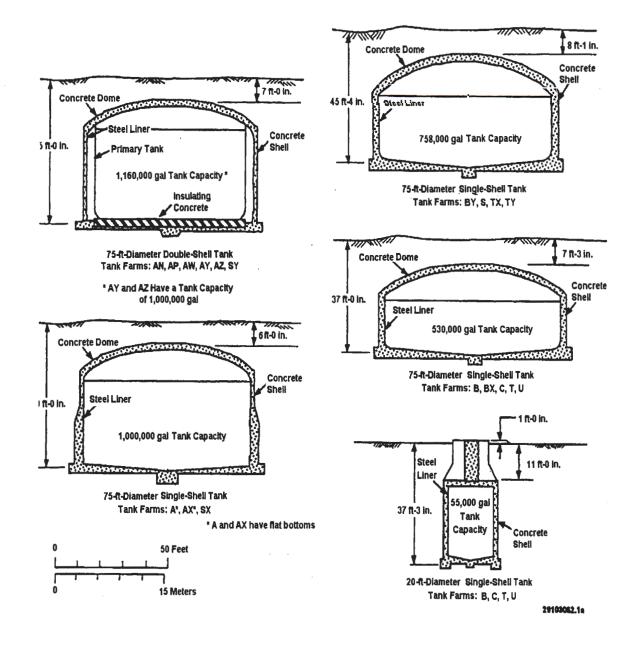

Surface Level Probe (FIC, ENRAF and Manual Tape) Solids Level Detector Camera Observation Port Dome Elevation Bench Mark Exhaust Stack Continuous Air Flow Monitor Annulus Pump Pit **Leak Detection Pit** Temperature Thermocouple Assembly Primary Steel Liner Operating Liquid Level Secondary Steel Liner Pump Pit-Reinforced Concrete Tank Concrete Steel Liners Annulus


Figure A-2. Double-Shell Tank Instrumentation Configuration

Liquid Observation Well Camera Observation Point Surface Level Probe (FIC, ENRAF and Manual Tapes) Solids Level Dome Elevation Bench Mark Detector Temperature Center Pump Pit Leak Detection Drywell Thermocouple Assembly Breather Filter (Exhausters used during in-tank operations) THE RESERVE OF THE PERSON NAMED AND ADDRESS OF THE PERSON NAMED ADDRESS OF THE PERSON NAMED AND ADDRESS OF THE PERSON NAMED AN Reinforced Concrets Tank Saltwell Screen Steel Saltcake and/or Sludge Interstitial Liquid Level Leak Detection Drywells A&SX Farms Only G05010040.3

Figure A-3. Single-Shell Tank Instrumentation Configuration

HNF-EP-0182, Rev. 201

CH2MHILL

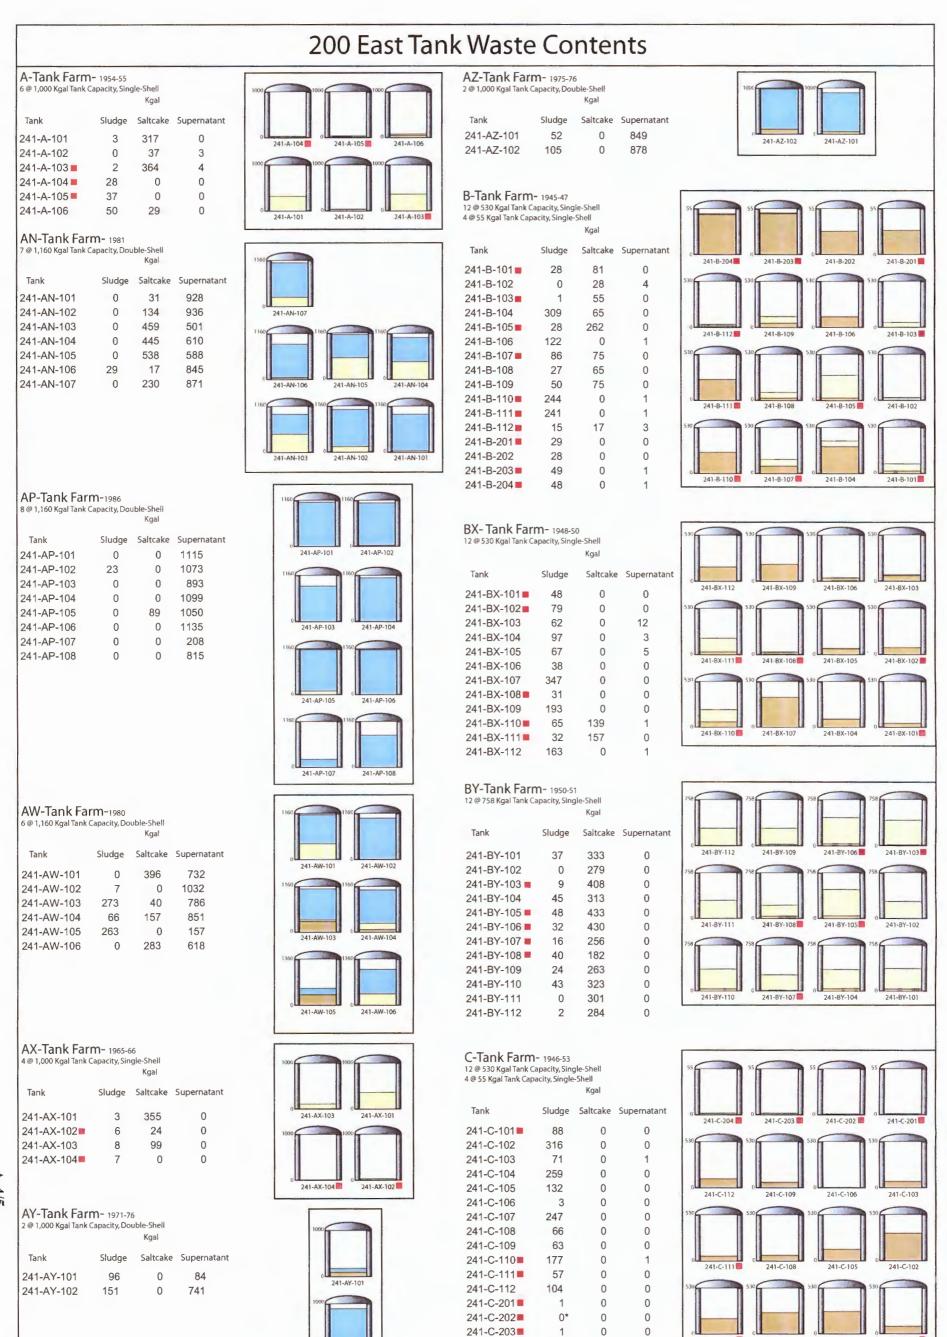

LEGEND

241-C-204


* (Less than 500 gallons)


0

2

0



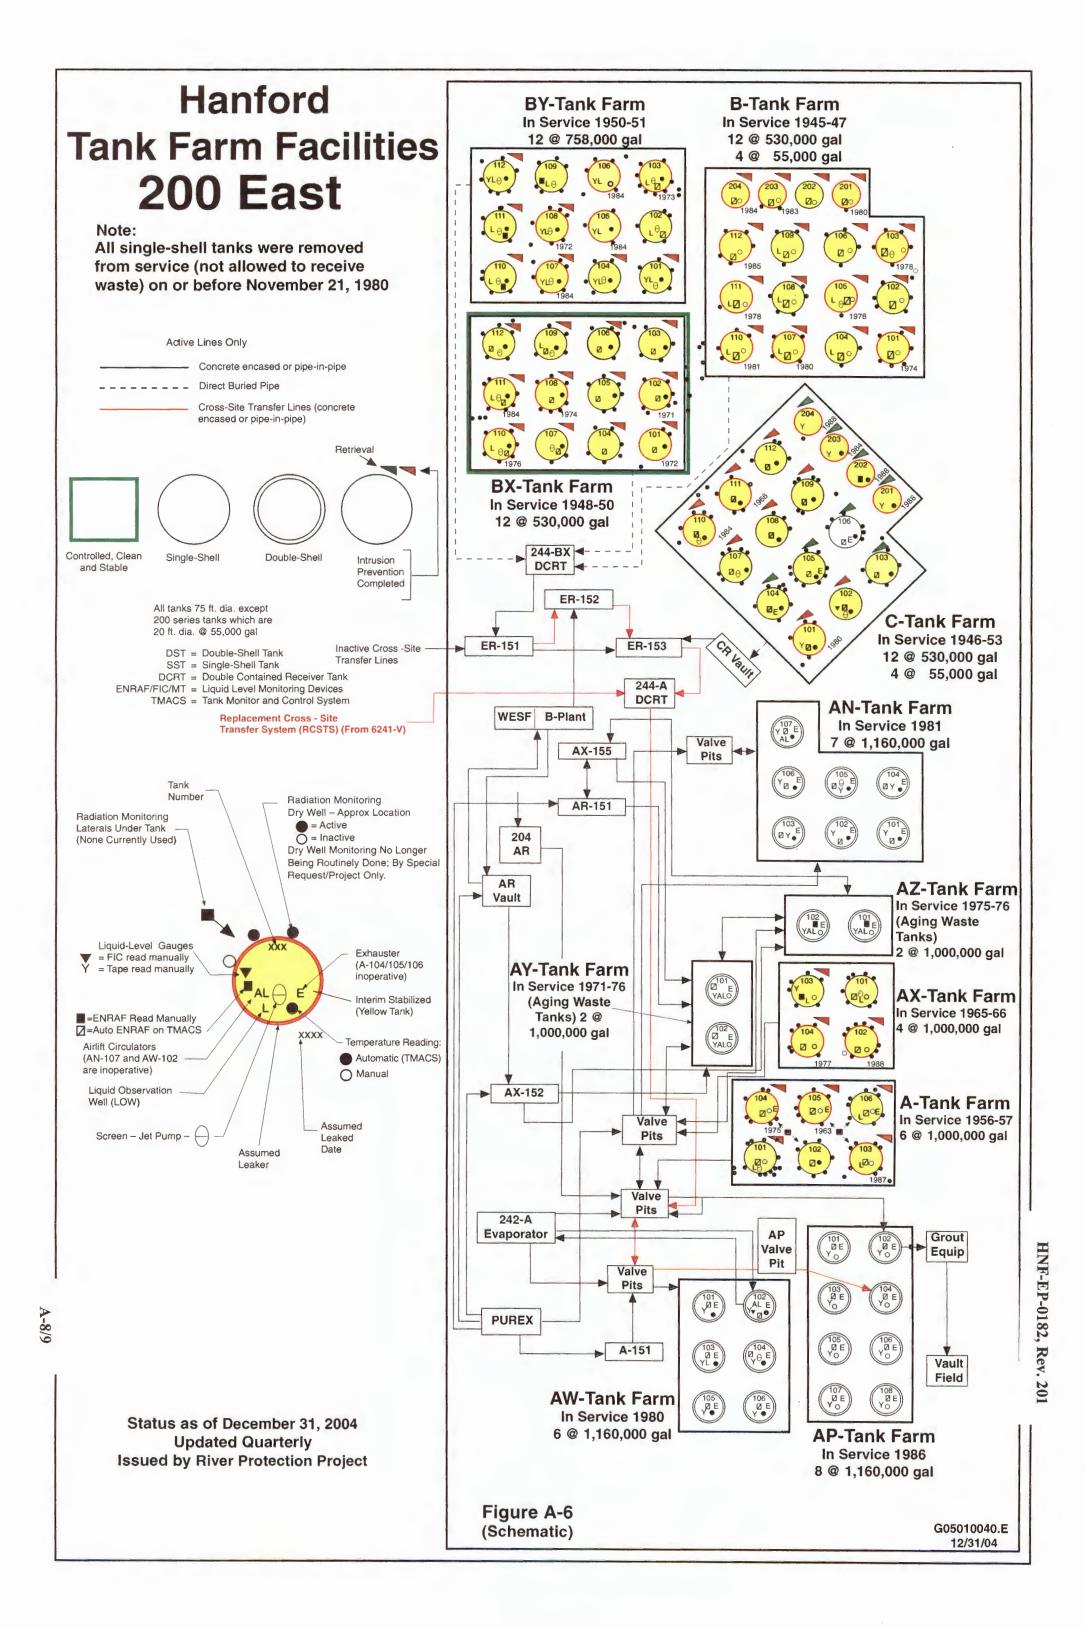

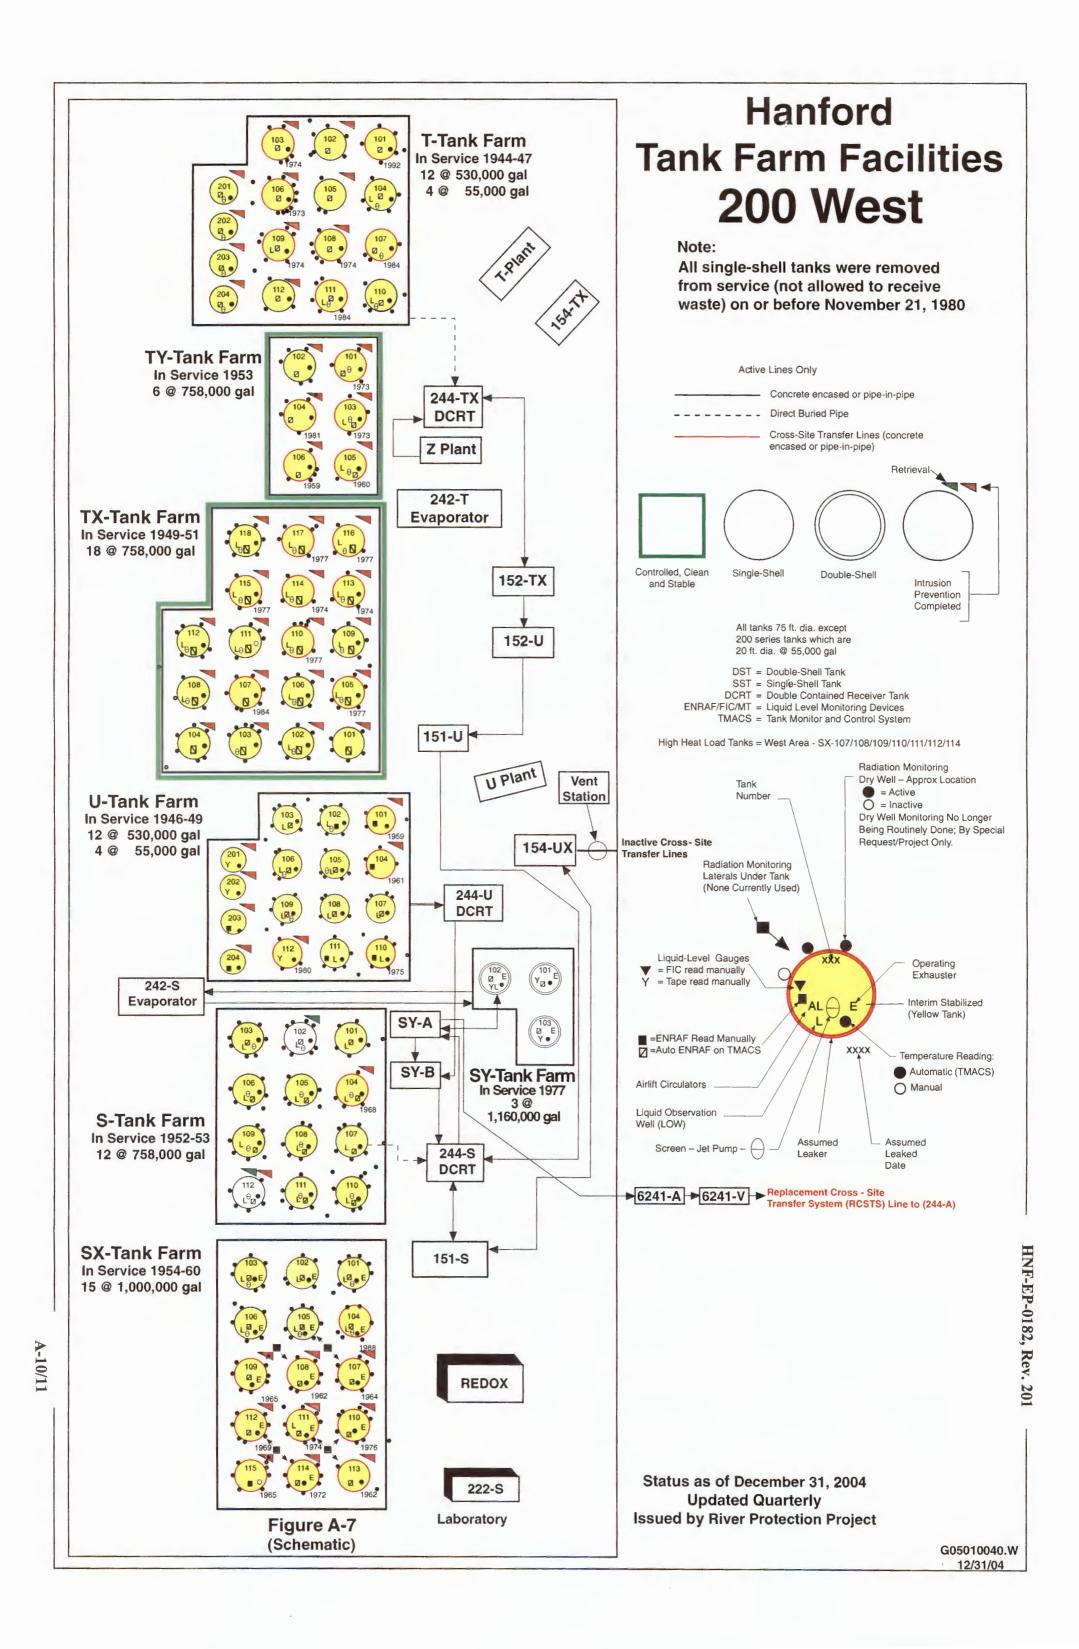

DISTRIBUTION LIST

Number of copies

OFFSITE - USA

2 Congress of the United States

U.S. Senate

717 Hart Senate Building Washington D.C. 20510

Senator Ron Wyden

U.S. House of Representatives

1323 Longworth House Office Building

Washington D. C. 20515

Congressman Richard "Doc" Hastings, 4th District

Atten: Jeff Markey

2 U.S. Department of Energy-Headquarters

1000 Independence Avenue, SW

Washington, D. C. 20585

Harry Calley

EM-44 Cloverleaf Bldg.

U.S. Department of Energy-Headquarters

19901 Germantown Rd Germantown, MD 20874

Kurt Juroff

EM-22 Cloverleaf Bldg.

1 Washington State Department of Ecology

Nuclear Waste Program

P. O. Box 47600

Olympia, WA 98504-7600

Roger Stanley

Washington State Department of Health

Radiation Protection 7171 Cleanwater Lane P. O. Box 47827

Olympia, WA 98504-7827

Allen W. Conklin

1 Oregon Department of Energy

Nuclear Safety Division 625 Marion St. NE Salem, OR 97301

Dirk Dunning, P.E.

Do not remove from distribution without permission from ODOE

1 MACTEC

8310 Centerbrook Place Alexandra, VA 22308

Stanley Blacker, Vice President

Do not remove from distribution without permission from addressee

1 <u>CH2M HILL</u>

9191 S. Jamaica St. Englewood, CO 80112

Dr. Bob Iotti, President and General Manager

Do not remove from distribution without permission from addressee

TRI-CITIES:

2 <u>Washington State Department of Ecology</u>

1315 W. 4th Avenue

Kennewick, WA 99336-6018

Jeff Lyon

Nancy Uziemblo

1 Tri-City Herald

P.O. Box 2608

Tri-Cities, WA 99302

John Stang

1 Robert J. Cash

114 Somerset

Richland, WA 99352-1966

1 Richard Welty

409 S. 41st Ave

W. Richland, WA 99353

Do not remove from distribution without permission from addressee

1 Gary Dunford

2417 Mark Ave

Richland, WA 99352

ONSITE

1	S. M. Stoller Corporation P. D. Henwood	B2-62				
1	General Accounting Office C. R. Abraham	A1-80				
3	Washington State Department of Ecology					
	B. K. Jentzen	H0-57				
	L. Fort	H0-57				
	Library	H0-57				
1	U.S. Environmental Protection A	<u>vgency</u>				
	David Bartus	H0-57				
10	U.S. Department of Energy					
	C. J. Bosted	H6-60				
	D. C. Bryson	H6-60				
	M. E. Burandt	H6-60				
	W. Hewitt (YAHSGS)	H6-60				
	D. H. Irby	H6-60				
	D. L. Noyes	H6-60				
	Wen-Shou Liou	H6-60				
	R. A. Quintero	H6-60				
	M. J. Royack	H6-60				
	Reading Room (P.H. McCormick)	H ₂ -53				
4	Bechtel National, Inc.					
	P. J. Brackenbury (3)	H4-02/MS5-L				
	Neil Brosee	H4-02/MS12-2B				
45	CH2M HILL Hanford Group, In	c. and Affiliated Companies				
	D. I. Allen	H6-03				
	J. C. Allen-Floyd	H6-64				
	E. S. Aromi	H6-63				
	E. Bitten	S7-70				
	K. M. Bowen	R2-12				
	J. M. Conner	S5-08				
	Q. R. Decker	S5-24				
	C. DeFigh-Price	R2-58				
	M. A. Fish	R1-14				
	R. A. Dodd	S7-83				
	J. († Field	H6-62				
	J. G. Field K. D. Fowler	H6-62 S5-08				
	K. D. Fowler	S5-08				
	K. D. Fowler K. A. Gasper	S5-08 H6-03				
	K. D. Fowler K. A. Gasper B. M. Hanlon (4)	S5-08 H6-03 R1-14				
	K. D. Fowler K. A. Gasper B. M. Hanlon (4) K. L. Hennesay (3)	S5-08 H6-03 R1-14 R1-10				
	K. D. Fowler K. A. Gasper B. M. Hanlon (4) K. L. Hennesay (3) B. A. Higley	S5-08 H6-03 R1-14 R1-10 R2-12				
	K. D. Fowler K. A. Gasper B. M. Hanlon (4) K. L. Hennesay (3) B. A. Higley T. M. Hohl	S5-08 H6-03 R1-14 R1-10 R2-12 R2-12				
	K. D. Fowler K. A. Gasper B. M. Hanlon (4) K. L. Hennesay (3) B. A. Higley T. M. Hohl P. Jennings	S5-08 H6-03 R1-14 R1-10 R2-12 R2-12 S7-95				
	K. D. Fowler K. A. Gasper B. M. Hanlon (4) K. L. Hennesay (3) B. A. Higley T. M. Hohl P. Jennings T. E. Jones	S5-08 H6-03 R1-14 R1-10 R2-12 R2-12 S7-95 E6-35				
	K. D. Fowler K. A. Gasper B. M. Hanlon (4) K. L. Hennesay (3) B. A. Higley T. M. Hohl P. Jennings	S5-08 H6-03 R1-14 R1-10 R2-12 R2-12 S7-95				

I C Vomen	H6-64
J. S. Konyu	
J. G. Kristofzski	H6-03
J. A. Lechelt	S5-08
V. E. Mehrer	R3-86
P. C. Miller	R1-51
A. N. Naiknimbalkar	R2-12
R. Ni	S7-66
S. L. Orcutt	R2-12
L. L. Payne	R1-14
R. S. Popielarczyk	R2-58
R. E. Raymond	H6-03
D. J. Saueressig	S7-20
L. M. Sasaki	S7-90
N. J. Scott-Proctor	S5-00
G. A. Stanton, Jr.	S7-03
J. A. Voogd	S5-23
Central Files	B1-07
200 East Shift Office	S7-02
WFO Shift Office	S5-15
Environmental	
Data Mgmt Center (2)	H6-08
Environmental Library	R1-51